


HANSER

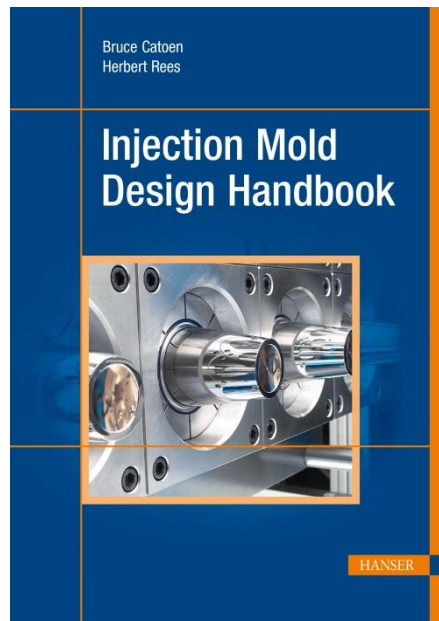

Sample Pages

Injection Mold Design Handbook

Bruce Catoen and Herbert Rees

ISBN (Book): 978-1-56990-815-0

ISBN (E-Book): 978-1-56990-816-7

For further information and order see

www.hanserpublications.com (in the Americas)

www.hanser-fachbuch.de (outside the Americas)

© Carl Hanser Verlag, München

Preface

From 1990 to 2005 I worked together with Herbert Rees on editing and writing books and manuals for both Husky Injection Molding Systems, where I worked in various engineering capacities, and for Hanser Publishers. Herbert was passionate about molds, design and engineering. As the VP of engineering at Husky during some of its most formative years, Herbert worked closely with Husky's founder, Robert Schad, and together they developed many machine and mold technologies.

Herbert passed away peacefully on Saturday, September 18, 2010, at the age of 95.

Over the years Herbert repeatedly told me that "An injection mold is the heart of any plastics molding work cell. Since the objective of every molder is to produce as many good parts as possible, each and every day they MUST understand the process and details of designing an injection mold". Throughout my career I have seen this proven true again and again. Understanding the principles of an injection mold design is fundamental to the success of the molded product and the molding operation.

Mold design encompasses every aspect of mechanical engineering including dynamics, statics, thermodynamics, materials, heat transfer and stress. As a result of its broad application of engineering principles it is a difficult subject to master and it results in a long learning curve for engineers. Much of the learning I received during my career was tribal knowledge based on the application of engineering principles. Gaining this knowledge took being in the right place at the right time or learning by trial and error. My hope is that this book helps short-circuit the process of learning good mold design practices.

This book is designed to be a reference handbook for the mold designer, engineer, project manager and production manager. Since designing an injection mold all starts with the plastic part, the book will first focus on key features and details of plastics and the plastic part which are necessary for good mold design. The design of the main components of an injection mold will be discussed and good design practices, rules of thumb, and key calculations will be shared. More than 600 figures, images and tables are provided in the book to illustrate how a mold should be designed. Chapter 18 contains more than 40 reference mold designs graciously

provided by mold-makers around the world. These references reinforce the previous chapters and illustrate how to apply the guidelines and principles from the book into a completed mold design. Finally, the process of testing and gaining customer acceptance of the mold for production will be detailed.

By using this book as a reference guide, the reader will be able to refer to it as needed to understand:

- Critical mold design features and design practices that will ensure a successful plastic part is molded
- Detailed steps, calculations and rules of thumb for mold design
- Critical aspects of mold design such as mold layout, mold shoe design, stack construction, cooling ejection, runner systems and materials selection
- Plastic part design requirements for a good mold design
- Processes for testing and gaining acceptance of the mold for production.

Bruce Catoen, August 2021

Acknowledgments

There are many people who helped put this book together, and I am so grateful for the time and materials that were provided to me. I would like to thank my editors and reviewers: Mark Smith from Hanser; Glenn Anderson for reviewing Chapter 5 and his contacts throughout the industry; Dr. Davide Masato, Assistant Professor at University of Massachusetts Lowell, for reviewing Chapter 11 on ejection and Chapter 12 on cooling, as well as his additional contributions on surface finishes; Fabrice Fairy for reviewing Chapter 14 on melt distribution and his boundless enthusiasm for hot runners; Vince Travaglini for reviewing Chapter 2 on part design and the tremendous help from StackTeck Systems; Vince Lomax for reviewing Chapters 9, 10, and 11, his wisdom, and the additional materials he provided on mold testing and alignment; Jordan Robertson for reviewing Chapter 5; Randy Yakimishyn for reviewing Chapters 9 and 10; Rocky Huber for reviewing Chapter 11 on ejection; Don Smith for reviewing Chapters 11 and 12 and the reference mold designs in Chapter 18; Christian Krammer for reviewing Chapter 19 and the checklists; and Dr. David Barden from Clearly Scientific Limited for his excellent edits and suggestions. Thanks to Christina Fuges for her help in connecting me with mold-makers and other industry experts to review the materials in the book.

The book would not be what it is without the generous support of the many mold-makers, hot runner suppliers, software providers, and machine manufacturers for the use of their mold designs, figures and pictures. I would like to thank: Gene Altonen CTO of IMFLUX; Paulo Silva, Managing Director of Plasdan; Mario Haidlmair, CEO of Haidlmair; Adam Chuickshank, CEO of Fourmark; Peter Smith, CEO of DME; Vince Travaglini, President of StackTeck Systems; Rui Tocha, the Director General of Centimfe; Oliver Lindenberg, VP of Global Sales Moldmasters; Andy Stirn, VP of Injection Machinery and Aftermarket NA Milacron; Mike Ellis, Global Business Manager for Hot Runners at Husky Injection Molding Systems; Miki Bogar, Senior Manager of Global Marketing at Mold-Masters; Andreas Kliber, GM of FDU Hotrunner; Stefan Von Buren, GM of MHS; Angela Vitz-Schiergens, VP Hotset; and Don Smith.

I am very grateful for all the time and effort it took to provide high-resolution drawings and figures with explanations. In particular, I want to thank: Alberto Silva at Plasdan; Fabio Och at Fourmark; Beth Thompson at DME; Jordan Robertson at StackTeck; Peter Peschl at Haidlmair; Sylvia Schmidt from Hotset; Rob Irwin at Nypro Mold; and Brenton Huxel at iMFLUX. I would also like to thank Anthony Yang and Srikar Vallury at Moldex3D for the use of figures from the *Molding Simulation* book.

Very special thanks to Jigish Shah, who provided much needed assistance with the creation of many figures for the book.

I am so grateful to Jim Sykes for his contribution of Chapter 17 on dimensioning and tolerancing.

Many thanks to Willi Miller, John DiSimone, Gord Mackay, Denis Babin, Manfred Lausenhammer, Randy Yakimishyn, and all the design and mold assembly people who took the time to teach me about mold design over the years.

Special thanks to the family of Herbert Rees for the use of materials from his books.

Finally, I want to say a very special thanks to my wife Shelley for her support, encouragement, and patience during the time it took to write this book.

The Author



Bruce Catoen, B.A. Sc.,
Mechanical Engineering,
P. Eng.

Bruce Catoen has more than 30 years of experience in the plastics industry and served as the Chief Technology Officer for Milacron and Mold Masters and as a senior executive at Husky Injection Molding Systems. Bruce is the named inventor on more than 50 patents and is author of the book *Selecting Injection Molds*. Through his consulting business, OASIC Consulting, Bruce advises senior executives on technology developments, business strategy, leadership and acquisitions. In addition to consulting, Bruce serves on two not-for-profit boards and mentors new engineers to Canada.

Contents

Preface	V
Acknowledgments	VII
The Author	IX
1 Introduction	1
1.1 Benefits of Injection Molding	4
1.2 The Injection Mold	6
1.2.1 The Role of the Injection Mold	6
1.3 What Is an Injection Mold?	7
1.3.1 Elements of an Injection Mold	9
1.4 Classification of Molds	13
1.5 Continued Innovation in Molds and Hot Runners	14
1.6 The Injection Molding Machine	14
2 Overview of Plastics for Mold Design	17
2.1 What Is Plastic?	17
2.2 Plastics Terminology	18
2.3 Polymer Orientation	20
2.3.1 Shrinkage	20
2.3.2 Multiple Shrinkages	22
2.4 Additives	23
2.5 Mechanical Properties of Plastics	24
2.6 How Molten Plastics Behave	25
2.6.1 How Plastics Flow	25

2.6.1.1	Pseudo-Plastic Behavior	26
2.6.2	Plastic Flow in Runners and Cavities	28
2.7	Degradation	30
2.8	Selection and Requirements for Plastic Materials	31
3	Plastic Part Design for Mold Designers	33
3.1	Plastic Part Drawing	35
3.2	Product Shape: How Can the Product Best Be Molded?	38
3.3	Parting Line (P/L)	41
3.4	Uniform Wall Thickness	43
3.5	L/t Ratio (Length of Flow Divided by Wall Thickness)	46
3.6	Drafts	47
3.7	Corners, Fillets, and Chamfers	48
3.8	Ribs and Bosses	49
3.9	Rim Designs	51
3.10	Stripped Undercuts	52
3.11	Sidewall Windows in the Part	52
3.12	Gate Location and Number of Gates	53
3.12.1	CAE Filling Analysis for Gate Location Optimization	57
3.12.2	Two or More Gates per Cavity – Large Products	59
3.12.3	Gate Dimple	61
3.12.4	Recessed Gate	61
3.12.5	Deep Undercuts and Mold Design Complexity	62
3.13	Re-Design of the Product to Avoid the Need for Side Cores	63
3.13.1	Selecting Other than the Conventional Parting Line	63
3.14	Shape of Threads and Undercuts	64
3.15	Need for Multi-Stage Ejection	67
3.16	Post-Molding Operations versus Mold Complexity	69
3.17	Plastic Part Tolerances and Effect on Mold Design	70
3.17.1	General and Specific Plastic Part Tolerances	72
3.17.2	Are Special Fits with Matching Products Required?	73
3.17.3	Tolerances for the Filling Volume	73
3.18	Stacking of Products and Free Dispensing	74

3.19	Deliberate Mismatches for Easy Mold Design	78
3.19.1	Mismatch at the Parting Line	78
3.19.2	Mismatch between Two Matching Pieces, such as Box and Lid	80
3.20	Surface Finish	81
3.20.1	Finish of Molding Surfaces	82
3.20.1.1	Molding Surface Finish for Ease of Ejection	84
3.20.2	Texturing of Surfaces	85
3.21	Fitting Surfaces of Mold Parts	86
3.22	Engravings	86
3.22.1	Engravings versus Applied Labels	86
3.22.2	Two-Color and Two-Material Engraving	87
3.22.3	Depth of Engravings	89
3.22.4	Font Style and Size of Artwork	90
3.22.5	Polarity of Engraving	91
3.22.6	Are the Locations Selected for Engraving Practical?	91
3.22.7	Engravings in the Walls and Bottoms of Products	92
3.22.7.1	Engravings on the Outside of the Product (Engraved Cavities)	92
3.22.7.2	Engravings on the Inside of the Product (Engraved Cores)	94
3.23	General Appearance of the Product	95
3.23.1	Flatness	95
3.23.2	Sinks and Voids	99
3.23.3	Witness Lines	101
3.23.3.1	Parting Line Flash	102
3.23.3.2	Gaps between Cavity and/or Core Parts and Inserts	102
3.23.3.3	Clearance of Ejector Pins and Ejector Sleeves	104
3.23.3.4	Hiding the Gate Mark	105
3.23.4	Weld Lines	105
3.23.4.1	Location of Weld Lines	106
3.23.5	Surface Defects (Flow Marks, Splay, Record Grooves, Haze, Jetting, Hooks, and Ripples)	107

3.24	Identification of the Molded Piece	109
3.25	Product Strength Requirements	110
3.25.1	The Role of Gate Location in Increasing Product Strength ...	111
3.26	Special Features	112
3.26.1	Holes and Counter-Bores for Assembly Screws or Rivets	113
3.26.2	Hinges and Snaps	114
4	Specifying the Right Machine for the Mold	117
4.1	Required Clamp Size (Tonnage)	120
4.2	Required Opening Stroke and Shut-Height	125
4.3	Platen Mounting Pattern and Ejector Positions	127
4.4	Locating Ring Size and Machine Nozzle Size	127
4.5	Extruder Sizing and Specification	127
4.5.1	Extruder Shot Size Calculation	128
4.5.1.1	Shot Size Calculation for Cold Runners	129
4.5.1.2	Shot Size Calculation for Hot Runners	131
4.5.1.3	Extruder Sizing Calculation	131
4.5.2	Requirements for Machine Plasticizing Capacity	132
4.5.2.1	Impact of Light-Weighting the Product	135
4.5.3	Screw Selection	136
4.6	Machine Nozzle Selection	136
4.6.1	Open Nozzles	137
4.6.2	Shut-off Nozzles	139
4.7	Injection Unit Selection	143
4.7.1	Reciprocating Screw versus Two-Stage Injection Units	143
4.7.2	Injection Speed and Pressure Requirements	145
4.7.2.1	Need for High Injection Pressures	149
5	Factors Affecting the Design of an Injection Mold	151
5.1	Total Equipment Productivity (TEP) Objectives	151
5.2	Cycle Time	153
5.3	Projected Annual Requirements	153
5.4	Purpose of the Mold	154
5.4.1	Prototype Mold	155

5.4.2	Experimental Mold	156
5.4.3	Combination of Prototype and Experimental Mold	157
5.4.4	Production Mold	158
5.4.5	New Products	158
5.4.6	Existing Product, Large Quantities	159
5.4.7	Limited Quantities, Limited Product Lifecycle	160
5.4.8	Short Runs, Small Production Requirements	160
5.5	The Injection Molding Machine	161
5.6	The Plant Environment	162
5.6.1	Condition of Ambient (Shop) Air	163
5.7	Coolant Supply	165
5.7.1	Is the Cooling Water Clean?	166
5.7.2	Chiller Sizing Guidelines	167
5.8	Power Supply	168
6	Cycle Time Estimation	171
6.1	Factors Impacting Cycle Time	172
6.1.1	Type of Plastic	172
6.1.2	Wall Thickness of Product	174
6.1.3	Mold Materials	175
6.1.4	Efficiency of Cooling	176
6.1.4.1	Molds for Small-Scale Production (Fewer than Approx. 1000 Pieces)	177
6.1.4.2	Molds for Large-Scale Production of Products 0.4–1.3 mm (0.015–0.050") Thick	177
6.1.4.3	Molds for Large-Scale Production of Products >3 mm (0.120") Thick	178
6.1.4.4	Molds for Most Other Products	181
6.1.5	Venting	182
6.1.6	Ejection	182
6.1.7	Molding Machine	183
6.1.7.1	Machine Dry Cycle	183
6.1.7.2	Timing of Ejection and Stroke Required	186
6.1.8	Impact of Cold Runners versus Hot Runners on Cycle Time ..	195
6.2	Estimating Cycle Time	196

7	Product Cost Estimation	201
7.1	Machine Hour Cost per Unit Molded	201
7.2	Mold Cost per Unit Molded	204
7.3	Labor Costs	206
7.4	Estimating Product Cost	207
8	Mold Layout, Drawings, and Inspection	217
8.1	Steps to Designing the Mold	217
8.2	Information and Documentation	218
8.2.1	Machine Specifications	220
8.2.1.1	Mechanical Features	220
8.2.2	Productivity Features	223
8.2.3	Additional Requirements	224
8.3	Determining the Mold Cavitation	227
8.3.1	Minimum Number of Cavities	228
8.3.2	Preferred (Practical) Number of Cavities	230
8.4	Assembly and Detail Drawings	231
8.4.1	Drawings and Views	231
8.4.2	Arrangement of Views	232
8.4.3	Notes on Drawings	233
8.4.4	Additional Information on the Drawings	233
8.5	Mold Layout and Assembly Drawings	233
8.5.1	Machine Platen Layout	233
8.5.2	Symmetry of Layout, Balancing of Clamp	234
8.5.3	The Views	234
8.5.4	Completing the Assembly Drawing	234
8.5.5	Bill of Materials (BOM) and “Ballooning”	235
8.5.6	Finishing Touches	235
8.6	Inspection Features on Drawings	236
8.6.1	Rollers or Roller Balls	236
8.6.2	How to Inspect Tapers	237
8.6.2.1	External Tapers	237
8.6.2.2	Internal Tapers	237

8.6.2.3	Angled Surfaces	238
8.6.2.4	Construction (Checking) Balls	239
8.7	Chamfers and Radii	240
8.7.1	General Information	240
8.7.2	Specifying Chamfers	241
8.7.3	Radii in Corners	242
9	Mold Shoe Design	243
9.1	Mold Plates	245
9.2	Mold Hardware	247
9.3	Location of Fittings, Hoses, and Cables	248
9.4	Forces Affecting Mold Shoes	248
9.4.1	Deflection of Mold Plates	249
9.4.2	Calculation of Plate Deflection and Stress	250
9.5	Selection of Materials for Mold Plates	252
9.6	Guiding of Moving Plates	253
9.6.1	Gibs	253
9.6.1.1	Pillars and Bushings	254
9.6.1.2	Dowel Pins and Bushings	254
9.6.1.3	Leader Pins with Piston and Stroke Limiters	255
9.7	Mounting Holes and Clamp Slots	256
9.8	Locating Rings	257
9.9	Mold Handling – Lift Holes, Lift Bars, and Latches	257
9.9.1	Lift Bars	257
9.9.2	Latches	260
9.9.2.1	Latches for Mold Servicing	260
9.10	Mold Identification Nameplates	263
10	Cavity and Core Design Overview	265
10.1	Mold Cavity Space	265
10.2	Plastic versus Steel Part Drawing	266
10.3	The Preliminary Stack Layout	267
10.3.1	Where Should the Parting Line Be Located?	267
10.3.1.1	Primary Parting Line	268

10.3.1.2	Secondary Parting Lines: Split Molds and Side Cores	270
10.3.2	Will the Product Pull out of the Cavity and Stay on the Core?	271
10.3.3	Will the Product Eject Easily from the Core?	273
10.3.4	Is the Cavity Balanced?	275
10.4	Determining the Method of Cavity Construction	276
10.4.1	Cavity and/or Core Are Cut Right into the Mold Plate	277
10.4.2	Individual Cavities and Cores	277
10.5	Stack Sizing and Total Area of the Stack	278
10.6	Forces on the Cores and Cavities	279
10.6.1	Checking for Sufficient Steel Shut-off Area in Stack	280
10.6.2	Checking for Stack Compression due to Clamp Tonnage	281
10.6.3	Checking for Acceptable Hoop Stress in the Cavity	283
10.7	Core and Cavity Material Selection	285
10.8	Determining the Stack Construction	286
10.9	Venting	287
10.9.1	Parting Line (P/L) Venting	289
10.9.2	Vent Grooves and Channels	289
10.9.3	Vent Pins	290
10.9.4	Venting of Ribs	291
10.9.5	Venting the Bottom of a Cavity	291
10.9.6	Core Cap and Core Sidewall Venting	292
11	Ejection	293
11.1	Manual or Semi-Automatic Ejection	294
11.2	Automatic Ejection	295
11.3	Basic Requirements for Ejection	297
11.3.1	Machine Opening Stroke for Ejection	297
11.3.2	Venting for Ease of Ejection	300
11.3.3	Surface Finish Forces on Ejection	301
11.3.3.1	Mold Surface Roughness	301
11.3.3.2	Molding Surface Finish Guidelines for Ejection ...	302
11.4	Force Required for Ejection	303

11.5	Where to Eject the Product	303
11.5.1	Ejection of Deep Cup-Shaped Parts	305
11.5.2	Ejection of Parts with Deep Ribs	305
11.5.3	Ejection of Bosses	307
11.5.4	Ejection of Shallow Parts	308
11.5.5	Ejection of Rim Shapes	309
11.5.6	Ejection of Cold Runners	311
11.6	Ejector Pins, Blade Ejectors, and Sleeves	315
11.6.1	Ejector Pin Clearance (Fit) and Length of Land	317
11.6.2	Blade Ejectors	318
11.6.3	Number, Size, and Location of Ejector Pins	320
11.6.3.1	Ejector Pin Sizing	320
11.6.3.2	Ejector Pin Locations	321
11.6.4	Finish of Ejector Pins and Bores	322
11.6.5	Preventing Ejector Pins from Turning	323
11.7	Ejector and Ejector Retainer Plates	324
11.7.1	Ejection Forces	324
11.7.2	Injection Forces	325
11.7.3	Number and Location of Machine Ejectors to Be Used	325
11.7.4	Calculation of Ejector Plate Deflection	325
11.7.5	Ejector Pin Retainer Plate	326
11.7.6	Ejector Return Pins	328
11.7.7	Ejector Box	329
11.7.7.1	Guiding Ejector Plates	331
11.7.8	Returning the Ejector Plate	332
11.7.8.1	Tie Ejector Plate to Machine's Ejector Plate	333
11.7.8.2	Linkages Attached to the Mold	333
11.7.8.3	Return Springs	333
11.7.8.4	Air Cylinders (Air Springs) for Ejector Return	336
11.7.8.5	Early Ejector Return Systems	337
11.8	Stripper Ejection	338
11.8.1	General Rules for Stripper Ejection	339
11.8.2	Guiding the Stripper Plate	341

11.8.3	Stripper Rings	343
11.8.3.1	Fixed Stripper Rings or Stripper Inserts	343
11.8.3.2	Floating Stripper Rings	344
11.8.4	Stripper Bars	346
11.8.5	Stripper Ring Ejection of Lids	347
11.8.6	Stripping from the Injection (Cavity) Side	348
11.9	Air Ejection	348
11.9.1	Requirements and Timing for Air Ejection	350
11.9.2	Poppet Air Ejection	351
11.9.3	Core Air	355
11.9.3.1	Fixed Core Air	355
11.9.3.2	Stroking Core Air	357
11.9.3.3	Combination of Air Poppet and Stroking Core Air	358
11.9.4	Blow-off Jets	359
11.9.5	Blow-down Jets	360
11.9.6	Air Ejection from the Cavity Side	361
11.10	Ejection of Significant Undercuts	363
11.10.1	Cam Ejection (Internal and External) Using Neck Rings	363
11.10.2	Core Pull Ejection	365
11.10.3	Collapsible Cores	367
11.10.4	Lifter Ejection	369
11.10.5	Sliders	371
11.10.5.1	Split-Cavity Movement on Angled Pins	374
11.10.6	Unscrewing Ejection	375
11.10.7	Cam and Harmonic Linkage Ejection	376
11.11	Multiple Ejection Strokes	377
11.12	Multi-Stage Ejection	378
11.12.1	Why and When to Use Multi-Stage Ejection	378
11.12.2	Typical Two-Stage Ejection Actuations	379
11.12.2.1	Latch Locks (Internal and External)	381
11.12.2.2	Two-Stage Ejection with Levers	383
11.12.3	Moving-Cavity Ejection Assist	384

12	Mold Cooling	387
12.1	Injection and Mold Temperatures for Common Plastics	390
12.2	Coolant Requirements for a Mold	391
12.3	What Affects Mold Cooling Performance?	392
12.3.1	Temperature of the Cooling Medium	393
12.3.2	Achieving Steady-State Temperature in the Mold	393
12.4	Principles of Heat Transfer and Thermodynamics	395
12.4.1	Heat Transfer Basics	396
12.4.2	Melting and Cooling Behavior of Plastics	398
12.4.3	Conduction and Thermal Conductivity	399
12.4.3.1	Thermal Conductivity Values	400
12.4.4	Convective Heat Transfer	401
12.4.4.1	Reynolds Number (Re)	401
12.4.4.2	Pressure Drop of Coolant Supply and Return Lines	403
12.4.4.3	Cross-Section of Channels	403
12.4.4.4	Length of Cooling Lines	403
12.4.4.5	Coolant Viscosity	403
12.4.4.6	Condition of Channels	404
12.5	Calculation of Cooling Requirements for a Mold	404
12.5.1	Heat Input Required to Condition the Plastic for Injection	404
12.5.2	Cooling Required to Remove the Inputted Heat	405
12.5.3	Temperature of Cooling Water	406
12.5.4	Quantity of Cooling Water Required	407
12.5.5	Efficiency of Cooling on Required Water Flow	408
12.6	General Cooling Design Rules	409
12.7	Cooling Channels in Plates	411
12.7.1	Series and Parallel Plate Cooling	412
12.7.2	Distance of Waterlines from Holes and Surfaces	415
12.7.3	Plugging of Cooling Channels	416
12.7.4	Plugs and Baffles in Plates	417
12.7.5	Cooling of Hot Runner Plates	419
12.7.5.1	Calculation of the Sizes of Cooling Channels for Hot Runner Plates	420

12.8	Layout of Cooling Channels in Inserts	422
12.8.1	Shrinkage of Plastic and Cooling Layout	424
12.8.2	Preventing Water Leakage in the Mold	426
12.8.3	Cooling Channel Distances in Inserts	428
12.8.4	Distance to Pipe Threads and Fittings	430
12.8.5	Cooling Channels Split between Inserts	430
12.8.6	Design of Insert Cooling for Flat Products	431
12.8.6.1	Drilled and Milled Cooling Circuits in Flat Parts ..	431
12.8.7	Cooling Design for Cup-Shaped Products	433
12.8.7.1	Cavity Cooling in Cup-Shaped Products	433
12.8.7.2	Core Cooling of Cup-Shaped Products	439
12.8.7.3	Cooling of Inserts	448
12.8.8	Use of CAE Molding Simulation for Cooling Design and Warpage Analysis	449
12.9	Supplying Water to the Mold	452
12.10	Thermal Expansion	453
13	Mold and Stack Alignment	455
13.1	Leader Pin and Bushing Alignment	457
13.2	Taper or Straight Interlock Alignment between Plates	459
13.3	Taper Lock between Each Cavity and Core	462
13.3.1	Backing up a Taper	466
13.3.2	Core Lock and Cavity Lock Alignment	467
13.4	Preloads	470
13.4.1	Restoring Preload by Grinding of the Tapers	474
13.4.2	Preload Stresses	475
13.4.3	Mounting of Stacks to Mold Plates	475
13.5	Over-Constrained Alignment	476
14	Melt Distribution and Gate Design	479
14.1	Cold Runners	481
14.1.1	Cold Runner, Single-Cavity Molds	481
14.1.2	Cold Runner, Two-Plate Molds	481
14.1.3	Cold Runner, Three-Plate Molds	483

14.1.4	Cold Runner Gate Types and Configurations	484
14.1.4.1	General Features of a Cold Runner Gate	484
14.1.4.2	Edge, Fan, Tab, and Diaphragm Gates	485
14.1.4.3	Tunnel Gates	487
14.1.4.4	Multiple Tunnel Gating	489
14.1.4.5	Curved or Submarine Tunnel Gating	489
14.1.4.6	Three-Plate Gates	490
14.1.4.7	Optimizing the Cold Runner Gate Placement	491
14.1.5	Layout and Balancing of Cold Runner Melt Channels	493
14.1.5.1	Multi-Cavity Runner Layouts (One Gate per Part)	496
14.1.5.2	Single-Cavity Multi-Gate Runner Layouts	499
14.1.6	Cold Runner Ejection	499
14.2	Insulated Runners	499
14.3	Hot Runners	500
14.3.1	Considerations for Specifying a Hot Runner	505
14.3.2	Overview of Hot Runner Design	506
14.3.3	Layout and Balancing of Hot Runner Melt Channels	507
14.3.3.1	Bridge and Sub-Manifolds	513
14.3.4	Melt Channel Sizing	514
14.3.4.1	Plastic Inventory in the Hot Runner	515
14.3.5	The Hot Runner Manifold	516
14.3.5.1	Locating the Manifold	516
14.3.5.2	Thermal Expansion of the Manifold, Sealing the Hot Runner Systems, and Nozzle Tip Position	517
14.3.5.3	Manifold Supports (Back-up Insulators)	518
14.3.5.4	Manifold Plate and Manifold Backing Plate	520
14.3.6	Heating of the Hot Runner	522
14.3.6.1	Basics of Resistance Heaters	523
14.3.6.2	Heaters	523
14.3.6.3	Heat Input per Mass of the Hot Runner Manifold ..	525
14.3.6.4	Thermocouples (T/Cs)	526
14.3.7	Hot Runner Nozzles	528

14.3.8	Nozzle Tips and Gating in Hot Runners	529
14.3.8.1	Hot-Tip Gates	530
14.3.8.2	Valve Gates	533
14.3.8.3	Slot Gating	537
14.3.9	Hot Runner Temperature Controls	538
14.3.10	Hot Runner Gate Location	539
14.3.11	Hot Runner Gate Sizing	539
14.3.11.1	Gate Sizing Methods	540
14.3.11.2	Gate and Melt Channel Size Calculation	541
14.3.11.3	Empirical Calculation of Gate Size	542
14.3.11.4	Gate Land Length	543
14.3.12	Gate Inserts (Gate Pads)	543
14.4	Hot and Cold Runner Molds in Combination	544
14.5	Selection of Hot Runner or Cold Runner System	546
15	Selection of Mold Materials	549
15.1	Forces on the Mold Affect Material Choices	550
15.1.1	Characteristics of Steels and Other Mold Materials	551
15.2	Steel Properties	554
15.2.1	Types of Steels	558
15.2.1.1	Pre-Hardened Steels	558
15.2.1.2	Tool Steels	558
15.2.1.3	Stainless Steels	559
15.2.1.4	Copper Alloys	559
15.3	Quality of Materials	559
15.4	Manufacturing Considerations for Choosing Materials	560
15.4.1	EDM	560
15.4.2	Welding	560
15.5	Heat Treatment	560
15.6	Overview of Surface Treatments	562
15.7	Hardness of Mating Parts	563

16	Fasteners	565
16.1	How Screws Work	567
16.2	Rolled versus Cut Threads	568
16.3	Holding Action and Preload of Screws	569
16.4	Influence of Temperature on Screws	573
16.5	Effect of Cyclical Loads on Screws	574
16.6	Screw Standards and Properties	574
16.7	Length of Thread Engagement	575
16.8	Additional Recommendations Regarding Screws	576
16.8.1	Always Use Standard Available Screw Sizes and Lengths	576
16.8.2	Increase the Depth of the Counter-Bore	577
16.9	Use of Set Screws	578
16.10	Holding Screws in Place (if Needed)	578
16.10.1	Lock Washers	578
16.10.2	Screw-Securing Compounds	579
16.10.3	Screws Secured by Plastic Inserts (Nylok™, etc.)	579
17	Dimensioning and Tolerancing	581
17.1	Conventional versus Geometric Tolerancing	583
17.2	Limitations of Conventional Dimensions and Tolerances	584
17.2.1	Origins of Measurement	585
17.2.2	Non-Repeatable Sizes and Centers	586
17.2.3	Orientation and Angles	587
17.2.4	Tolerance Accumulation	589
17.3	Geometric Dimensioning and Tolerancing	591
17.3.1	Three Core Steps for Applying or Inspecting GD&T	592
17.3.2	Geometric Tolerancing Benefits versus Conventional Tolerancing	593
17.3.2.1	Clear Setup and Origins of Measurement	593
17.3.2.2	Geometric Controls Apply to Features, not to Dimensions	595
17.3.2.3	Repeatable Sizes and Centers	597
17.3.2.4	Tolerance Accumulation Is Minimized	597
17.3.2.5	Tolerance Zones Are Uniform	598

17.3.2.6	Control of Patterns of Features	598
17.3.2.7	A Single Interpretation	598
17.4	Implementation of Geometric Tolerancing	598
17.4.1	Implementation of GD&T-Lite (not Recommended)	599
17.4.2	Implementation of GD&T Integration	599
17.4.3	Implementation of Model-Based Definition	600
17.5	Considerations for Tolerancing	601
17.5.1	CAD Modelling Practices	601
17.5.2	Materials, Manufacturing, and Inspection	602
17.5.3	Thermal Expansion and Tolerancing	603
17.6	Application of GD&T to Mold Components	603
17.6.1	GD&T Applied to an Injection Mold Core	604
17.6.2	GD&T Applied to an Injection Mold Lock Ring	606
17.6.3	GD&T Applied to an Injection Mold Core Plate	608
17.6.4	GD&T and Mold Engineering	611
18	Mold Design References	613
18.1	Plastic Housing (Using Shut-offs)	613
18.2	Facemask	615
18.3	Plastic Cutlery	618
18.4	Vial	621
18.5	Open-Ended Floss Spool Tube	623
18.6	Overcap Lid (Using Stripper Ring Ejection)	626
18.7	Plug Lid	628
18.8	Urine Tub Cap (Using Stripper Ring Ejection)	634
18.9	Deli or Yellow Fats Container (Using Air Ejection and with Cavity Lock Alignment)	637
18.10	Stadium Cup (Using Core Lock Alignment)	640
18.11	Polystyrene Tumbler (Using Stripper Ring Ejection)	643
18.12	False-Bottom Cup (Using Moving Cavity and Air Ejection)	648
18.13	Round Closure (Using Stripper Ring (Bump-off) Ejection)	649
18.14	Paint Pail with Handle Inserts	652
18.15	Rectangular Container with Tamper-Evident Skirt	654
18.16	Power Tool Housing	657

18.17 Rear Hatch Door	662
18.18 Crinkle Bag	663
18.19 Preform (Using Neck Ring Ejection)	665
18.20 Living Hinge Cap	670
18.21 Rectangular Box with Undercuts (Using Split-Cavity Mold)	673
18.22 Detergent Cap (Using Unscrewing Ejection)	674
18.23 Folding Crate	679
18.24 Automotive Panel Cover	682
18.25 Pallet	683
18.26 Automotive Covers	685
18.27 Double-Walled Threaded Cap (Using Collapsible-Core Mold)	687
18.28 Automotive Cover	689
18.29 Externally Threaded Cap Mold	690
18.30 Oxygen Mask (with Side Core Retraction)	692
18.31 Living-Hinge Case	694
18.32 Iron Housing (Using Split-Cavity Mold)	697
18.33 Oral Care Product (Using Split-Cavity Mold)	699
18.34 Actuator (Using Split Cavity with Multi-Stage Ejection)	705
19 Mold Testing, Approval, and Troubleshooting	707
19.1 Information to Be Supplied to the Mold Tester	707
19.2 Dry-Cycle Testing before Injecting Plastic	708
19.2.1 Bluing to Ensure Proper Shut-off, Venting, and Taper Fit	710
19.2.2 Procedure for Aligning Mold Halves in the Injection Molding Machine	712
19.2.3 Lead Test Procedure to Check Wall Thicknesses and Alignment	712
19.3 Initial Mold Start-up and First Shots	713
19.3.1 Mold Start-up Procedure	714
19.4 Changing Materials or Colors	718
19.4.1 General Color Change Procedure	719
19.5 Mold Test Information and Data to Be Collected	720
19.5.1 Core Shift Mapping	721

19.6	APQP and PPAP	722
19.7	Mold Test Troubleshooting Guide	723
20	Appendix	733
	Appendix 1: Mold Material Properties	733
	Appendix 2: Frequently Used Conversion Factors	735
	Appendix 3: Plastics and their Abbreviations	737
	Appendix 4: Mold Design Review Checklist	739
	Appendix 5: Contents of a Mold Manual	745
	Appendix 6: Mold Setup Guide Template	746
	Appendix 7: Order Confirmation Template	751
	Appendix 8: General Properties of Plastics	753
	Appendix 9: Thermal Properties of Plastics	755
	Appendix 10: Mechanical Properties of Plastics	757
	Appendix 11: Thermal and Processing Properties of Plastics	761
	Appendix 12: Mold Preventative Maintenance Checklist	766
	Appendix 13: Surface Finishes	767
	Index	769

1

Introduction

Injection molding is a relatively new process compared to other manufacturing processes. However, in a very short period of a few decades injection molding has become one of the world's most productive and cost-effective means of producing a high-quality product.

Injection molding is a process by which plastic pellets are melted using heat and shear in an extruder and injected, at high pressure and flow, into an injection mold to form the part. While this process seems straightforward, it is full of engineering challenges and complexities.

An injection molding work cell can consist contain 4 to 16 separate elements (dryer, hopper loader, machine, hot runner, mold, robot, conveyer, etc.). Many of these elements will be standard catalog items. However, there will ALWAYS be one unique element in the work cell, and that is the mold. The mold is the **heart of the system** and all the other elements of the work cell must work together to make the unique plastic part. It is therefore critical and fundamental that the mold be designed with the utmost care and attention to detail, for if the mold does not operate as intended, then the entire work cell will operate in a subpar condition.



An old saying goes that “injection molders make money on weekends”. The intended meaning is that a molder must run the first five days of the week to cover their costs, and they make profit when running throughout the weekend.

What is also written between the lines here is that injection molding is a 7-days-a-week, 24-hours-a-day business. Molders only make money when the molding work cell is producing parts. If the work cell cannot make a good part then efficiency is zero. *Molders only make money by putting good parts in the box. As a result, mold design is a critical aspect to every molded part.* Since a work cell could be in operation for many years, the mold must not only perform well on day one, but also until the last day that the production is needed.

Due to the importance of the mold design, it is critical that all levels of personnel in the molding plant and the mold-making facility understand the basics of good mold design, and the techniques used to create a mold that will allow it meet and exceed its intended purpose.

This book is therefore intended to be used, not just by the mold designer, but also by every person who comes in contact with the injection mold, so that they too can understand what makes a good mold and contribute in a meaningful way to building it.

With new, possibly difficult shapes, decisions on how to design the mold are usually left to the ingenuity of a mold designer. More frequently, *precedents* from earlier molds are used and re-applied. However, the mold designer and every person who will be involved in the molding operation must be aware of (and evaluate) new ideas, new methods, and developments, which when applied, would lead to better-quality, higher-productivity, simpler molds, and savings in the cost of the molded products.

Before proceeding with any mold design, the mold designer must understand what kind of mold should be selected. In other words, which features will be most suitable for the application to achieve the most economic *overall* manufacturing method for the product. This means not just specifying the number of cavities that will be required for the expected output, but also the *selection of mold materials and the degree of sophistication* of the mold. Any planned automation, especially in product handling *after molding*, can affect the mold layout, particularly spacing and orientation of the stacks. The mold designer must never lose sight of the ultimate goal: **to produce a part that meets or exceeds all specified requirements, at the lowest possible cost.**

The most important piece of information to know before deciding on the mold design is the quantity of parts to be molded. However, this is a piece of information, particularly with *new* products, that is often very difficult to obtain.

When looking at the overall cost of a plastic part, the per-piece cost of the mold is generally a few percent of the overall part cost (Figure 1.1 and Figure 1.2). However, the upfront cost of the mold may seem quite high. But due to the fact that it is a unique, one-off, engineered product made with very high-precision equipment to very tight tolerances by highly skilled tradespeople, the cost is realistic. On the other hand, a poorly engineered and manufactured mold is worthless, as it cannot produce a single good part.

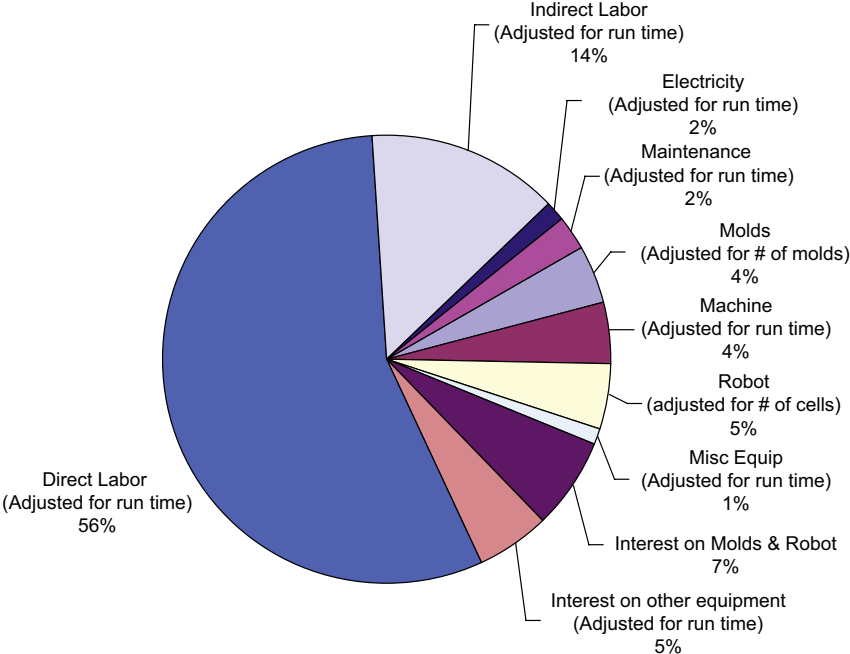


Figure 1.1 Conversion cost of an injection-molded medical part (resin excluded)

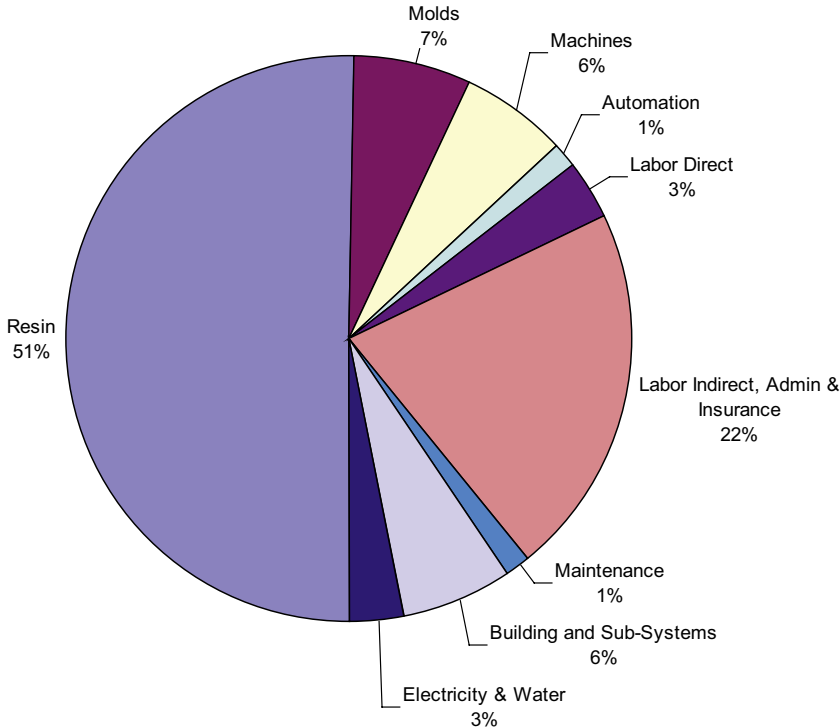


Figure 1.2 Part cost of an injection-molded pail

It should also be pointed out that of the total cost of almost all plastic products, the cost of the plastic material alone constitutes the greatest component. The most sophisticated, best-designed mold will not lower the cost of the product by as much as the reduction of just a few percent of the amount of plastic material, if it could be removed from the product without affecting its quality or serviceability. Most often, unnecessarily heavy wall thickness and ribbing affects the cost more than anything else. Chances are that the lowest weight will be achieved with the highest quality molds.

The foremost intent of this book is to present, in a logical sequence, the steps and choices available to the mold designer or decision maker when planning a mold for a new product, or when planning to increase the productivity for a product for which a mold exists. The book poses many of the questions that must be asked by anybody who needs a mold built. Any question left unanswered could significantly affect the productivity as well as the cost of a mold. For an experienced mold designer, the answers to many of these questions often come automatically, without being aware of the fact that a decision has been made. But even the most experienced mold designer can gain important information by systematically investigating all areas that can affect the design and the complexity of the mold, and checking to ensure that no obvious facts have been overlooked.

■ 1.1 Benefits of Injection Molding

Today, injection molding is probably the most important method of processing plastics in the production of consumer and industrial goods, and is performed everywhere in the world. The benefits of using injection molding for a product or part of a product are vast and compelling. Some of the benefits are as follows:

- Low cost and high efficiency: With injection molding, a processor can produce parts in massive quantities at very low costs without high complexity or expensive skilled labor. An injection molder can set up a factory in a basic warehouse.
- Easily adapts to automated processes: Injection molding can be almost entirely automated with relative ease and low cost.
- Very high shape flexibility: Almost any shape and detail you can imagine can be injection-molded.
- Injection molding can produce parts with high tolerances and very highly detailed features or finishes.
- Excellent part properties such as light weight, high strength-to-weight ratio, excellent impact resistance, and low corrosion.

- Previously produced assemblies of multiple parts using other materials such as metal can be consolidated into one plastic part.
- Almost infinite color possibilities.
- Injection molding creates a net shape part without needing subsequent finishing.
- Plastics are easy, safe, and efficient to transport.
- Injection molding is a widely used and accepted process, so it is easy to find molders to make any part.

Before proceeding to use injection molding, the designer should always consider whether injection molding is the best solution to mold the part. Have alternative methods or product designs been considered or investigated, employing other manufacturing processes using the same or a similar materials, or using other materials which may permit a similar end product, possibly even with better quality, and/or at lower cost? A few typical examples of possible manufacturing alternatives to injection molding are:

- Thermoforming, foam molding, or blow-molding
- Coining and die-stamping (blanking)
- Machining.

The designer should also consider if other materials would be better suited to meeting the project objectives, such as:

- Paper (cardboard), wood, or cloth
- Metals (steel, aluminum, etc.)
- Glass or ceramic.

Once the decision has been made to use *injection molding* for a new product, a number of critical steps lie ahead, which will be addressed in this book:

- Plastic part design
- Factors affecting the design of an injection mold
- Mold design
- Testing and acceptance.

■ 1.2 The Injection Mold

The heart of every injection molding work cell is the mold. It contains the form of the part that will ultimately be filled with plastic. It plays the most critical and fundamental role in the entire process – forming the part. The mold forms the desired end product. All of the other pieces of equipment in the molding work cell work to help produce a high-quality part. However, most of the other pieces of equipment in the work cell act in support of the mold.

1.2.1 The Role of the Injection Mold

Today, an injection molding work cell can contain up to 16 discrete pieces of equipment (see Figure 1.3). These devices all serve to help make a good-quality plastic part. In essence, the mold is the heart of the system, as all the other generic devices in the work cell allow the mold to make a good part. While the generic components of the work cell do not change, they must adapt every time a new mold is installed in the injection molding machine. It is therefore critical to understand the basics of an injection mold and what makes a good plastic part.



Figure 1.3 Fully automated injection molding work cell for DVD cases, containing 16 components in the work cell (Courtesy of Husky Injection Molding Systems Ltd.)

All of the supporting devices to the mold need to be correctly sized and functional in order to make the mold work well. *An injection molding work cell can be considered to be like a symphony orchestra, with the mold being the conductor. If the devices are not in tune with each other, then the whole work cell sounds like a bad high-school band, and they each contribute to making poor-quality plastic parts.* If, on the other hand, all of the supporting equipment is good working order, is correctly sized and maintained, then the resulting plastic parts will be better quality, and the work cell will run for longer without issues.



The old saying “the chain is only as strong as the weakest link” holds true in injection molding.

■ 1.3 What Is an Injection Mold?

An injection mold is a permanent tool, i.e., a tool that, if properly designed, constructed, and maintained will have a life expectancy (useful life) *well beyond* the time where the product itself becomes obsolete. This differentiates it from a “one-time use” mold such as a sand-casting mold, as used in metal foundries. A mold can be used to make products in a virtually infinite variety of shapes, made from injectable plastics. Common to all molds is the condition that it must be possible to remove the product after molding, without the need to destroy the mold (as is the case in sand-castings).



There is an exception to this, the so-called “lost-core molding”: There are injection molds for intricate products, such as intake manifolds for internal combustion engines, previously made from cast iron, which have an outside shape that *can* be molded with conventional (permanent “open and close”) molds, but where the intricate *inside shape* is made from a molded, low-melting-point metal composite, which is inserted into the mold before injection, and then ejected together with the molded product. The metal is then removed by heat at a temperature above the melting point of the insert, but of course below the melting point of the plastic used for this product. The molded metal insert is thereby destroyed, but the metal will be reused.

A basic mold consists of two mold halves, with at least one cavity in one mold half, and a matching core in the other mold half. These two halves meet at a *parting plane* (parting line). Once the injected plastic is sufficiently cooled, the mold opens and the product can be removed by hand or be automatically ejected.

Because injection molding machines are mostly built with the injection on the stationary platen side, there is typically no built-in ejection mechanism on this side. If ejection from the injection side should be required – which is always the case in *stack molds*, and occasionally so in single-level molds – any required mechanism must be added to the mold, and occasionally to the machine; in either case, this adds complexity and increases costs. Only molds designed for using only air ejection do not require any external ejection mechanism.

Most products are removed (ejected) from the core. There are also many molds that need special provisions to allow the products to be removed from either the cavity or the core. This is the case for products with severe undercuts or recesses on the inside and/or the outside of the product, such as screw threads, holes, ribs or openings in the sides of the product, etc., or molds for insert molding.

Some of these design features of the product may require moving side cores, which are either inserts or whole sections of the cavity that move at an angle which is 90° to the “natural opening path” of the mold. Others may require special unscrewing mechanisms, either in the core or in the cavity side. The mold may require split cavities (or “splits”), i.e., the cavity consists of two or more sections, which are mechanically or hydraulically moved in and out of position, and then clamped together during injection. In some cases, the mold may require collapsible cores, or retractable inserts, which are all quite complicated (and expensive) methods.

Any of the above special features can add considerably to the mold cost when compared to a simple “up and down” mold where the products can be readily ejected with the machine ejectors during the mold opening stroke or after the mold is open, without the need for any of these complicated mold features.

Note that in this book, the term (simple) “up and down” molding is used, which comes from the earlier vertical molding machines, even though, today, most general-purpose injection molding machines are horizontal, and the mold opens and closes in a horizontal motion.



Example:

To illustrate how different mold features affect the mold cost, let a single-face mold with air ejection of the products cost X dollars. A similar mold, but with mechanical ejection, costs about $1.2X$. A similar, air-ejected two-level stack mold will be about $1.8X$. An unscrewing mold for a similar-size mold and product will cost about $2X$.

1.3.1 Elements of an Injection Mold

There are books that show designs of numerous specific molds, but it is virtually impossible to show every possible configuration that may be required. It is more important for the designer, and any person requesting a new mold, to understand that a mold consists essentially of a number of elements, from which the most appropriate for the purpose is chosen.

The reader is encouraged to read one of the following books for more a more detailed understanding of the engineering of an injection mold:

- *Gastrow Injection Molds* [1]
- *Injection Mold Design Engineering* [2].

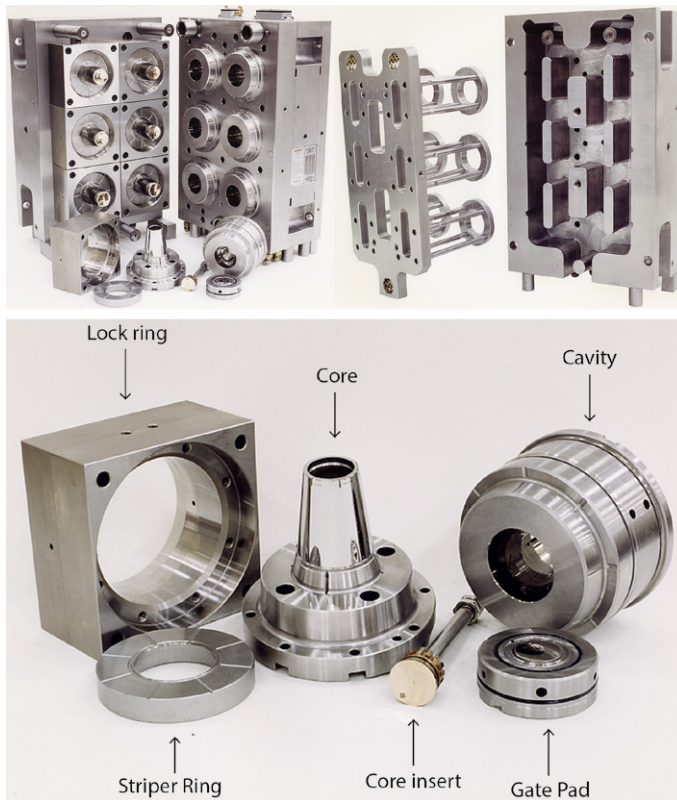


Figure 1.4 Parts of an injection mold (Courtesy of Husky Injection Molding Systems Ltd.)

[1] P. Unger (ed.), *Gastrow Injection Molds* (4th edn), Hanser Publishing, 2006.

[2] D. Kazmer, *Injection Mold Design Engineering*, (2nd edn) Hanser Publishing, 2016.

Every injection mold consists of the following basic elements (see Figure 1.4 and Figure 1.5):

1. One or more matching cavities and cores, defining the cavity space(s) (today, there are molds with anywhere between one and 256 cavities).
2. A method, or element, to duct the (hot) plastic from the machine nozzle to the cavity spaces. There is a choice between:
 - Cold runners (two-plate or three-plate systems)
 - Hot runners (various systems)
 - Insulated runners
 - Sprue gating (cold or hot).
3. Provision to evacuate air from the mold (venting). There is a choice between:
 - Natural venting
 - Vacuum venting.
4. Provision to cool the injected hot plastic sufficiently to allow ejection of the molded product.
5. Provision to eject the molded product. There is a choice between:
 - Manual product removal
 - Ejector pins and sleeves
 - Strippers (stripper rings or bars)
 - Air ejection
 - Free-drop ejection onto a conveyer
 - Various methods for in-mold product removal
 - Robotic product removal.
6. Provision to attach (interface) the mold to the molding machine. There are several methods to consider:
 - The mold is for one machine only. In this case the mold may be mounted with bolts to the platen
 - The mold is to be used on several, different machines. In this case, clamps and clamp slots on the mold may be used to bolt the mold to the platen
 - Quick mold-change methods (various designs). This could involve magnetic mounting.
7. Method of alignments of cavities and cores. There are several methods to consider:
 - No alignment feature provided in the mold. Also called flat parting line
 - Leader pins and bushings (2, 3, or 4)

- Leader pins and bushings between individual cavities and cores
 - Taper fits between individual cavities and cores
 - Taper fits between plates. These are also called side locks
 - Any combination of the above.
8. Any number of (mold) plates to provide the necessary means for carrying and providing rigid back-up for the above elements.

In addition to the above parts, molds can have additional features, which will also be discussed in the following chapters. Each of these features can add (often considerable) costs to the mold, but in many cases they increase the productivity of the mold and reduce the cost of the product. Not all may be necessary, and each must be carefully considered when deciding on the type of mold that is most suitable (and most economical) for the job on hand.



Easy serviceability of the mold is important but often overlooked. It adds some mold cost, but saves much more in future servicing costs and downtime.

Ease of serviceability of the mold may affect the mold cost up front, but will ultimately reduce the lifecycle cost of the plastic part by reducing the need to remove the mold for service or repair. One example is the access to the hot runner for cleaning plugged gates or making minor repairs, such as changing a nozzle, a burned-out heater, or a faulty thermocouple at a hot runner drop. Building in functionality to conduct these repairs in the molding machine will cost more in the initial mold, but this will be easily recouped by reducing the downtime necessary to accomplish such repairs. By designing easy access to these components in the machine (without the need to remove the whole mold, or part of it, to the bench), such repairs can be made in less than an hour, instead of taking several hours. This work can also be done by the mold setup staff rather than getting the (expensive) mold makers involved.

Another area where valuable maintenance time can be saved is to design and provide easy access from the parting line to screws holding modular molding surface parts to their mounting plates, while the mold is in the machine. Since damage to the molding surfaces or parting lines can occur, it is advantageous to have the molding surfaces serviceable in the press. This is particularly valuable in high-cavitation molds.



Even minor changes to the part can dramatically lower or increase mold costs.

Defining what is *really* required considering the shape and complexity of the product and the required production quantities will enhance mold productivity. Alternatives and options should ALWAYS be considered and reviewed with all personnel before the mold design is finalized. Each department that interfaces with the mold will look at the design with a different set of eyes for their needs. It is of the utmost importance to include them in design reviews to ensure that the mold will have all the necessary features and functions.

Figure 1.5 shows a schematic of a basic injection mold with the key elements of the mold labelled with conventional terminology. It should be noted that the terminology used in the figure is used by the author, but there could be other names used for these components as well.

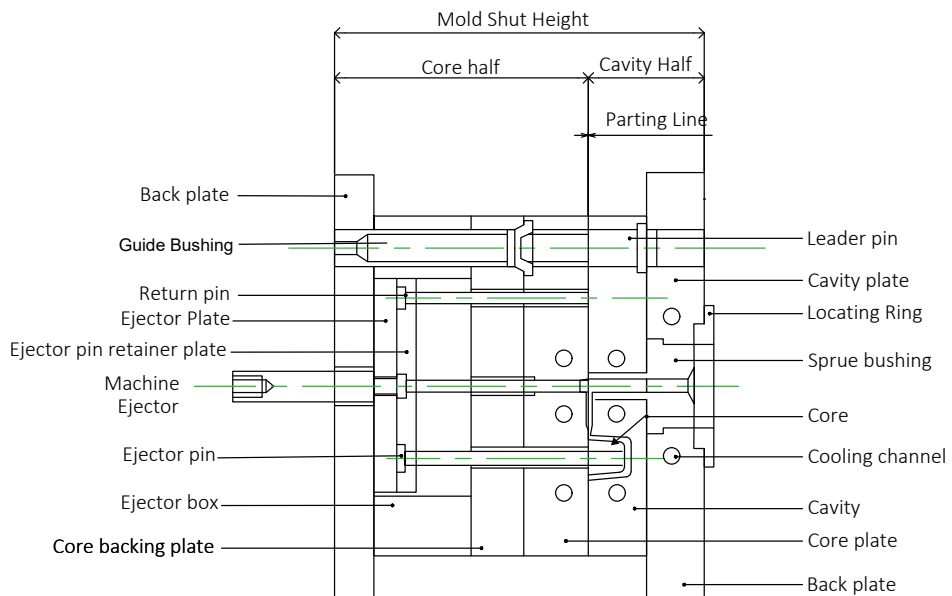


Figure 1.5 Mold terminology

■ 1.4 Classification of Molds

SPI has developed a set of standards to classify molds by their design and intended usage. Table 1.1 explains the different standards.

Table 1.1 SPI Mold Specifications ^[a]

Class	Cycles	Description	Mold base	Inserts	Other
101	> 1,000,000	Built for extremely high production. This is the highest-priced mold and is made with only the highest-quality materials.	Pre-hardened 28Rc steel Stainless steel plates	All hardened > 48Rc steel Cooled inserts	Guided ejection Wear plates on slides
102	< 1,000,000	Medium to high production mold, good for abrasive materials and/or parts requiring close tolerances.	28Rc steel	Hardened steels Cooled inserts	Some guided components Some corrosion protection
103	< 500,000	Medium production mold. This is a very popular mold for low to medium production needs.	8Rc steel	> 28Rc steel	Guiding optional
104	< 100,000	Low production mold. Used only for limited production preferably with non-abrasive materials.	Mild steel or Al	Mild steel or Al	None
105	< 500	Prototype only. This mold will be constructed in the least expensive manner possible to produce a very limited quantity of prototype parts. It may be constructed from cast metal or epoxy or any other material offering sufficient strength to produce minimum prototype pieces.	Mild steel or Al	Mild steel or Al	None

[a] For more details on mold materials and the use of the Rockwell hardness scale (Rc), please refer to Section 15.2.

■ 1.5 Continued Innovation in Molds and Hot Runners

While the use of molds dates back thousands of years, innovation continues in mold and hot runner design. There are thousands of patents on injection molding, and thousands more just on hot runners. The industry continues to innovate to provide customers with ever better ways to mold plastic products. The reader is encouraged to keep aware of the emerging trends in injection molding and to learn about how these new ideas could help to create a better injection mold. Some of the most recent trends are:

- *Conformal cooling of inserts using metal 3D printing:* Allows mold designers a additional level of design freedom in creating the cooling circuit, compared to drilling and milling multiple complex inserts and materials.
- *Direct 3D printing of plastic parts versus injection molding:* A potential threat to injection molding itself, it allows for customized creation of parts for joint replacements, running shoes, and other items that require high levels of customization.
- *Electrification of molding functions using servo motors and drives:* Functions such as rotations and stroking of pistons are now being electrified.
- *Internet connection of devices to make them “smarter”,* called the industrial internet of things (IIoT or Industry 4.0).
- *Multi-material molding:* The creation of a part with multiple materials in a single process, e.g. toothbrushes, parts with integrated sealing, or parts with multiple colors.
- *Co-injection molding:* The creation of a part with multiple layers for extending shelf life, using recycled materials, and creating new aesthetics.
- *Use of gasses and liquids in the process* to core-out thick parts or to add/embed the gasses in the part for light-weighting.
- Continued development of *new resins and fillers* to create better plastics.

■ 1.6 The Injection Molding Machine

The accuracy of molding, and especially when molding products that are difficult to produce, is very dependent on the quality of the molding machine, its mechanical rigidity, accuracy of alignment, parallelism of platens, the quality of its controls, and the state of maintenance. As mentioned previously, the equipment in a

molding work cell works together in unison, and the system is only as good as its weakest link. So a high-quality mold installed in a molding machine that is poorly set up or engineered will not make a good part. The machine must be able to meet the requirements of the mold that is being installed. A good machine, poorly aligned and maintained, can destroy a new mold in a matter of months. It is imperative that the molder's machine is in good shape to ensure that the mold will perform as intended, for the lifetime intended. If this is not the case, the mold may suffer from continuous problems and issues that cannot be rectified.



There is no point in buying a premium-priced mold only to run it in an out-dated machine.

Every good injection molding machine consists of the following basic elements (see Figure 1.6):

1. A rigid base that is welded (not bolted) together using stiff box steel members.
2. A rigid clamping unit, consisting of two cast or machined platens, for the mounting of the mold halves and provisions for guiding the platens (tie bars or linear ways). The thickness of the platens is a good indicator of the rigidity and quality of the machine.
3. Provision for moving the platens, preferably fast relative to each other, for opening and closing the mold in an adjustable fashion using a fast microprocessor. Toggle-style machines tend to be the quickest machines, and fully hydraulic machines the slowest.
4. Provision for clamping, i.e., holding the mold shut against the force of the injection pressures within the mold (in some machines, provisions 3 and 4 are combined). Clamp force can be built up using hydraulic fluids or electric motors.
5. Provision for ejecting the molded product(s) from the mold. The provision can be within the mold or, more commonly, using an ejection means on the machine such as an ejector plate behind the moving platen.
6. Provision to transform the raw plastic pellets into an injectable melt. This part of the machine is called the plasticizing unit or extruder. This is almost always done using a barrel and rotating screw. The melting of the plastic is done using a combination of shear from the rotating screw and heat from the barrel heaters.
7. Provision for injecting the melt into the mold (in most machines, provisions 6 and 7 are combined in one unit). Sometimes the creation of the melt and injection of the melt are split into two separate elements. In this case the injection unit is normally called a two-stage injection unit. The injection stage is then

normally an injection or shooting pot. The injectable melt is transferred to the pot by the extruder, and a separate means then injects the melt into the mold for the shooting pot. The advantage of this more expensive approach is that the injection is more accurate and the extruder can be creating more melt while the shooting pot is injecting plastic. This can result in significantly lower cycle times.

8. Cycle controls (sequencing logic, timers, etc.) and an interface for the operator to make adjustments to the process and to operate the machine in manual or semi-automatic modes.
9. Heat controls for all heaters in machines and molds. Some machines have a limited number of heat controls, and additional controls could be required for the molds, especially with larger hot runner systems. This point must be considered when estimating the mold cost.
10. Safety gates to protect operators and bystanders from all hazards when operating the machine.
11. Mechanical safety elements to prevent closing the machine when gates are open, in case of failures of the other (electric and hydraulic) safety measures.
12. Provision for cooling water distribution to the mold.
13. Provision for compressed air, for auxiliary actions required in the mold.

There are other features available, for example, for the convenience of quick mold installation, automation, set-up and operation of the mold and machine. These features are often offered as options that can be bought with the machine or added on later.

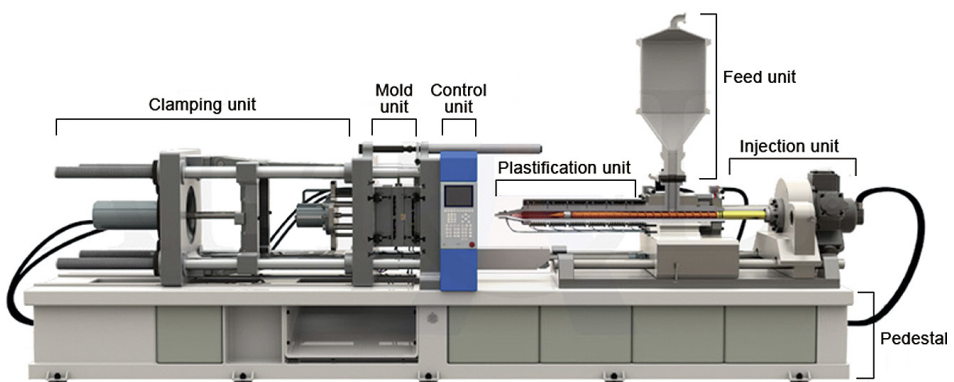


Figure 1.6 Schematic of an injection molding machine (side view) (Courtesy of Moldex3D)

Index

Symbols

3D finite-element modeling software 400
3D printing 14

A

abrasion-resistant 544
acceptable hoop stress 283
accumulator 224, 225
– package 224
accumulator system 148
actuator 255
additives 23
air actuators 378, 384, 648
air assist 194, 348
air blast 359
air circuits 639
air cylinder 255, 336
air eject 637, 642
air-eject 467
air ejection 8, 222, 293, 348, 361, 638
air entrapment 725
air insulation 521
air leak 732
air lines 440
air only 194
air-operated actuators 225
air operators 378
air pistons 535
air poppet 626
air poppets 352
air pressure and volume 224
air springs 336
air streaks 725
air supply 350
align cores and cavities 465
aligning mold halves 712
alignment 247, 298, 343, 411, 455, 471, 477,
506, 618, 621, 644, 656, 664, 712
– features 234
alignment elements 247, 453
alignment method 456
ambient air 163
American Society of Mechanical Engineers
(ASME) standard Y14.5 591
amorphous 19
amorphous plastics 21, 389, 398
angled guide pin 374
angled horn pin 658
angled moving core 369
angled pin 371, 372
angled pins 374
angled surfaces 238
angle of attack 374
angle pins 270
angles 587
angular tolerances 588
annual operating hour 229
annual requirements 153
annular 531
annular gates 532
antifreeze 393
antistats 23
appearance 483
application of GD&T 603
APQP 722
arched bottom 97
“artificially” balance 507, 512
artwork 90
ASME Y14.5 591, 596, 603, 612
assembly 427
assembly drawing 231, 234, 579
atmospheric pressure 403
automatic ejection 379
automatic product removal 191
automotive 662, 682, 685, 689
auxiliary actuators 233
auxiliary controls 222
auxiliary datum 609, 610

B

- back-fill 106
- backing plate 435
- backing up 270
- backing up a taper 466
- back-pressure 133
- back-up 466
- backup 278
- back-up insulator 517, 519
- back-up insulators 518, 521
- back-up support 521
- baffle 440
- baffle cooling 655, 682, 684
- baffles 417, 431, 433, 435, 437, 614, 616, 642
- baffles and rods 417
- balance 668
- balanced air channels 350
- balanced layout 507
- balanced runner layout 496
- balanced runners 506
- balancing melt channels 507
- ballooning 235
- barrel heaters 714
- barrels 489
- beam deflection calculation 251
- bearings 376
- Beaumont, John P. 501, 723
- BeCu 544, 639, 642, 643, 655
- bending 550
- bending moment 698
- beryllium-copper 175, 388, 446
- beryllium-copper alloys 448
- beryllium-copper tip insert 444
- beverage crates 272
- bill of materials 231, 235
- blade ejector 318
- blade ejectors 293, 315, 613
- blades 411
- blisters 727
- blockage 717
- block copolymer 19
- blow-down 347, 360
- blow-down air 642
- blow-down nozzles 640
- blow-downs 225
- blower 225
- blow jet 359
- blow off 638
- blow-off 351
- blow-off air 642
- blow-off jet 350
- blow-off jets 359
- blow-off vent 645
- blow slot 356
- blow slots 355
- bluing 43, 710
- bluing compound 710
- bolts 565
- bosses 49, 182, 307, 321, 363, 613, 658
- boundary layer 389
- box shape 38
- Bozzelli, John 723
- branched polymer 18
- brazed 512
- brazing 510
- breakers 226
- bridge manifolds 513
- British standard pipe threads 417
- brittle 300
- brittleness 727
- BSP 417
- bubbler 353, 355, 440, 442, 448, 676, 689
- bubblers 441, 448, 623
- bubbles in part 728
- bucket 652
- buckle 321
- burning 287, 725
- burning in manifold 731
- bushing 254, 457
- bushings 247, 455, 456

C

- CAE analysis 22, 57
- CAE cooling analysis 449
- CAE flow analysis 39, 53
- CAE molding simulation 449
- CAE molding simulation software 39
- CAE simulation 400
- CAE simulation software 199
- CAE software 248
- calories 396
- cam 376, 677
- cam ejection 363
- cam followers 384
- cam profile 668
- cams 364, 378, 380
- cam system 364
- cap 687
- carriage forward 715
- cartridge heaters 523
- cascade 442
- cavitation 456, 459
- cavitation trends 154

- cavity 265, 278, 626, 629, 644, 666
 - construction 276
 - space 121, 224
 - spacing 503
 - walls 550
- cavity air 347, 350
- cavity cooling 433, 642
- cavity expansion 279
- cavity inserts 434
- cavity lock 639
- cavity lock alignment 467, 637
- cavity space 265, 288
- cavity surface 540
- CBW Automation 644
- center back-up insulator 516
- center ejector 325
- center-gated 234, 483
- center support 519
- chamfers 240
- channels 403
- Charpy V-notch test 554
- chase 278
- checking ball 239
- chiller 391, 393, 406
- chiller sizing 167
- chrome 552
- chrome-plated 556
- chroming 638
- circuit breakers 227
- circular gate 531
- circular grooves 431, 438
- circular pattern 621
- clamp force 248, 473
- clamping 15
- clamping force 222, 268, 279, 281, 574
- clamp slots 256, 679
- clamp speed 392
- clamp stroke 222
- clamp tonnage 280
- closure 649
- coarse thread 569
- coarse threads 566
- co-injection 14
- cold and hot runner molds 226, 544
- cold clearance 517
- cold runner 195, 223, 314, 480, 481, 614, 658, 700
- cold runner ejection 311, 499
- cold runner gate 484
- cold runner gate placement 491
- cold runner molds 169, 311
- cold runner pullers 311
- cold runners 10
- cold slug 352, 530, 533
- collapsible core 369, 687
- collapsible cores 64, 275, 367
- colorants 23
- color changes 481, 483, 503
- color changing 718
- color concentrate 718
- commodity molded part 207
- composite cavities 277
- compressed 424
- compressed air 288
- compressibility 20
- compressibility of plastic 424
- compressibility of steel 281
- compression 280, 282, 550, 574
- compression of the plastic 305
- compression sealing nozzle 528
- compressive strength 555
- compressive stress 320
- computer 409
- concentric cooling 431
- concept 267
- conduction 391, 395
- conductivity 388, 389, 430
- confirmation of order 751
- conformal cooling 14, 688
- container 349
- containers 235, 298
- contaminants 166
- contamination 225, 393, 481
- control algorithms 538
- control datum features 593
- controlled removal 295
- controlling patterns 598
- control of the datum features 604
- controls 378
- convection 395
- convective heat transfer 401
- conventional dimensioning 584, 586
- conventional dimensioning and tolerancing 595
- conventional plus-minus tolerancing 581
- conventional tolerances 583
- conventional tolerancing 587
- conversion cost 208
- conversion factors 735
- coolant 403
- coolant connection 233, 234
- coolant flow 401
- coolant requirements 391
- coolant supply 392, 403, 435
- coolant temperature 165
- cooling 387, 422, 668
 - channels 556

- line layout 234
- water supply 226
- cooling calculations 420
- cooling channel layouts 409
- cooling channels 411, 430
- cooling circuit 453, 618, 668
- cooling lines 314, 403, 540, 662
- cooling medium 393
- cooling pattern 632
- cooling performance 392
- cooling process 398
- cooling small inserts 448
- cooling system 393
- cooling temperatures 407
- cooling time 393
- cooling tower 391, 393, 406
- cooling water 406
- cooling water supply 165
- copolymer 19
- copper alloys 556, 559
- core 265, 277, 278, 629, 644, 666
 - backing plate 648
 - shift 506
- core air 347, 350
- core backing plate 254
- core base 627
- core cap 355, 445
- core cap air 642
- core cap vent 642
- core-cavity alignment 650
- core cooling 439, 642, 645
- core cooling circuits 440
- core insert 445, 614, 626, 676
- core inserts 664
- core lock 643, 666
- core lock alignment 467, 640
- core pin 306
- core plate 614
- core pull 365, 658
- core pull design 367
- core ring 358
- cores floating 475
- core shift 286, 654, 721, 729
- core shift mapping 721
- core sidewall venting 292
- core to cavity alignment 629
- corner radii 48
- corners 48
- corrode 166
- corrosion 416, 552
- corrosion resistance 556
- cost 3, 4
- cost of direct labor per hour 206

- counter-bore 247, 577
- counter-bores 113, 241, 242
- counter-boring 572
- crinkle bag 663
- critical dimensions 459
- cross-drilling 438, 448, 543
- cross-hatching 235
- cross-manifolds 513
- crystalline 19
- crystalline materials 398
- crystalline plastics 21, 389
- crystallinity 173
- cup shape 459
- cup-shaped parts 304, 350
- cup-shaped product 272, 348
- cup-shaped products 274, 433, 439
- current 523
- curved runner extension 489
- cutlery 618
- cut threads 569
- cycle time 153, 171, 195, 196, 295, 318, 391, 393, 394
- cycle times 219
- cyclic 475
- cyclical load 429
- cyclical loads 249, 574
- cyclic loading 256, 283, 333
- cycling loads 577
- cylindrical shut-off 535

D

- dark spots 726
- datum feature 606–608
- datum feature identifiers 592, 593
- datum features 604
- dead pocket 648
- decompressed 530
- dedicated molders 229
- deep cup-shaped parts 305
- deep-draw containers 222
- deep-draw lid 347
- deep-draw part 463, 721
- deep rib 291
- deep ribs 305
- deep threads 674
- de-flashing 294
- deflection 249, 550, 571, 684
- deflection temperature 755
- degating 294, 543
- degradation 30, 540
- degrade 505
- degrading 515

delamination 727
deliberate mismatches 78
deli container 637
de-nest 76
density 753
Designing Plastic Parts for Assembly 34
detail drawings 231, 235
detergent cap 674
diaphragm gates 486
Dicronite™ 85
dieseling 725
dieseling effect 287
differential pressures 286
difficult-to-cool 411
difficult to fill 728
diffusion-bonded 512
diffusion bonding 510
dimensioning 236, 581
dimple 61
DIN 912 574
dirt 404, 503
discoloration 727
disposable cup 434
distance of waterlines 415
domed 644
double-acting piston 352
double-helix spiral 442
double-sided label 628
double-spiral cooling 433
double-spiral layout 431
double-V sealing 676
double wall threaded-cap 687
dovetail 682, 687
dowels 254, 255
draft 47, 222, 271, 324
draft angle 272, 306
draft angles 302
drawings 231
draw-stoning 84
drill bits 416
drill bushings 313
drilling 572
drinking cups 97
drool 731
drooling 530, 540
dry cycle 183
dry-cycle 713
drying 392
dull spots 727
dull spots @ gate 726

E

early ejector return 337
ease of ejection 300
ease of polishing 556, 682
edge gate 485
edge-gated 623
edge gates 485, 531, 533
EDM 91, 93, 319, 560
EDM finish 84, 85
efficiency of cooling 408
ejecting from the bottom 304
ejecting from the rim 304
ejection 84, 182, 273, 293, 405, 654, 656, 668
ejection forces 324, 379
ejection from the injection side 361
ejection mechanism 297
ejection of bosses 307
ejection of shallow parts 308
ejection sequence 658, 670
ejection stroke 194
ejection temperature 408
ejection time 185
ejector backing plate 660
ejector bars 663
ejector box 316, 329, 331, 359, 645
ejector box cutout 331
ejector force 305
ejector mechanism 304, 431
ejector pin 104, 311, 317, 664, 700
ejector pin clearance 317
ejector pins 104, 247, 288, 293, 315, 613, 618, 660, 680, 682, 684
ejector pin sizing 320
ejector plate 329, 338, 615, 651, 659, 680, 682, 684, 685
ejector plate return 293, 554
ejector plates 104
ejector retainer plate 254, 310, 313, 326, 660
ejector retainer plates 324
ejector rod lengths 708
ejector sleeve 316
ejector sleeves 288, 308, 315, 613
ejector stroke 222
eject the cold runner 312
electric power 226
electric resistance heaters 523
electrification 14
electroless nickel plating 552
electroless nickel process 252, 402
elongation at yield 757
embedded geometric tolerances 600
energy 391, 396, 398

engraving 90, 93, 109, 110, 323
engravings 86, 89, 91, 92, 94
ENP 562
entrainment effect 361
equal cooling 654
equilibrium 394, 399
equivalent length 403
Euro 221
Exair™ 361
excessive wear 728
expanded 424
expansion forces 520
experimental mold 156
experimental molds 549
experimental setup 219
external latch lock 687, 690
externally threaded cap 690
external return springs 335
extruder 391
extruder screw 391
extruder size 503
eye bolt 332

F

facemask 615
fake vestige 105
false bottom 648
false bottom cup 648
family molds 234
fan gates 486
fast cooling 440
fast ejection 300
fasteners 565
fatigue 283, 429, 553
fatigue strength 249, 283
fatigue stress 283
FDU 665
feather-edge 311
feed throat 719
fillers 23, 110, 173, 543
fillets 48
filling simulation 491
filling volume 73
fine threads 566
finish 324
finish of ejector pins 322
first cycle 716
first shots 713
fit 318
fit issues 51
fits-based tolerancing 601
fittings 430

fixed adjustable blow-off pin 638
fixed core air 355
fixed front mounted 643
fixed stripper rings 343
flame retardants 24
flank angle 66
flank of the thread 66
flash 268, 730
flash chrome plate 163
flashing 102, 338, 356, 473
flash mark 486
flat 38
flat ejector pin 318
flatness 95
flat parting line 623
flat product 424
flat products 431
flexural modulus 757
flexural strength 24, 757
flip-top 670
float 255, 470, 650
floating core 284, 341
floating cores 343
floating stripper rings 342, 344
flow 61, 313, 393, 540
flow analysis 694
flow analysis software 486
flow capacity 410
flow control 435
flow fronts 663
flow imbalance 495
flow leaders 98
flow length 540
flow lines 725, 726
flow marks 107
flow of coolant 392, 404
flow of grain 568
flow of heat 406
flow passages 479
flow rate 403
flow restrictors 107
folding crate 679
force calculation 279
force required to eject 303
forces 550
Fourier's law 397
Fourmark 654
free fall 295
free-fall 328, 361
freeze-up of gates 60
freezing 532
freezing off 59
friction 507

frictional force 301
friction angle 568
front-mounted 639, 650
frozen 530

G

gage blocks 237
galling 728
gas springs 664
Gastrow Injection Molds 39
gate 438, 529
– grain structure 552
– retainer plate 648
– size 505
gate area 431
gate breaks cleanly 484
gate damage 488
gate freeze 530
gate insert 104, 438, 543, 616, 626, 642, 666
gate inserts 473, 543
gate land 530, 543
gate location 53, 111, 539
gate marks 105
gate pad 438, 543, 642, 644, 650
gate pad cooling 438
gate pads 473, 543
gate pad split 642
gate protrusion 61
gates 519
gates freezing 724
gate size 535, 539, 540
gate stringing 724
GD&T 595, 598
GD&T integration 599
GD&T-Lite 599
Geometrical Product Specifications (ISO-GPS) 591
geometric dimensioning and tolerancing 581, 591
geometric tolerance determination 601
geometric tolerances 582, 583
gibs 253
glass fibers 543
good draft angle 307
good venting 648, 710
graft copolymer 19
gravity 361
grinding 84
grinding allowance 561
ground faults 538
guide bushings 341
guide pins 256, 342, 648

guiding ejector plates 331
gun-drilled 511
gun drilling 416
gussets 53

H

Haidlmair 615, 662, 663, 679, 683
handled products 55
handle inserts 652
handling the mold 476
hanging up 297
hang up 304
hang-up 511
hard chrome plating 562
hardened steel 544
hardened wedges 456
hardness 551, 555
harmonic linkage ejection 376
haze 107
heat 388, 394, 396, 398, 523
– controllers 226
– loss 505
– treatment 560, 561
heat balance 395
heat conducting 174
heat conduction 399
heat conductivity 175, 399, 404
heat content 398
heat deflection temperature 24
heat energy 399
heater 524
heater capacity 525
heaters 226, 391, 522
– cartridge 525
– tubular 524
heat exchanger 391
heat expansion 475, 516, 517
heat flow 519
heating units 393
heat input required 404
heat insulated 506
heat loss 505
heat losses 523, 526
heat sink 524
heat stabilizers 24
heat transfer 388, 393, 395
heavy cross-sections 431
heavy sections 411
heavy-walled products 426
helix 442
hierarchy of feature attributes 593
high-heat screws 573

- highly viscous 507
- high pressures 529
- high productivity 160
- high shear rates 529
- high shrinkage 73
- hinge 115
- hinge pin 69
- hinges 114, 681
- hobbing 92, 147, 727
- hoist hole 332
- holding force 568
- holes 113, 272, 553
- hollow parts 533
- homo-polymer 19
- hooks 107, 725
- hoop stress 279, 283
- hopper 714
- horn pin 371, 658, 694
- horn pins 270, 700
- hose connections 423
- hose lines 435
- hot and cold runner molds 544
- hot-cold-runner 484
- hot cores 728
- hot edge gate 618
- hot gate area 438
- hot half 501
- hot hardness 556
- hot plastic 719
- hot runner 195, 234, 438, 505, 541
 - manifold 505
 - molds 226
- hot runner design 506
- hot runner gates 60
- hot runner gate size 540, 542
- hot runner heaters 526
- hot runner leakage 717
- hot runner manifold 516, 525
- hot runner molds 169
- hot runner plate cooling 420
- hot runner plates 420
- hot runners 10, 54, 419, 500
- hot runner system 391, 525
- hot spots 199, 403
- hot sprue 652
- hot-stamped 88
- hot-tip 530
- hub 306
- Husky Injection Molding Systems 626, 639–641, 646
- hydraulic actuators 378
- hydraulic circuit 682
- hydraulic cylinder 670, 677

- hydraulic cylinders 684
- hydraulic diameter 497
- hydraulic ejection 347
- hydraulic ejector force 324
- hydraulic machine ejectors 333
- hydraulic operators 378
- hydraulic pistons 535
- hydraulic pump 391
- hydraulic pumps 148
- hydraulic supply 225

I

- identification 109
- IIoT 14
- imbalanced filling 518
- iMFLUX 618, 621, 623, 670, 687, 690, 694, 699
- iMFLUX process 700
- impact modifiers 24
- impact strength 554
- implosion 307
- impurities 252
- infinite life 475
- initial mold start-up 713
- inject against the core 55
- injection forces 325
- injection molding machine 161, 183
- injection pressure 20, 149, 222, 224, 278, 325, 550
- injection speed 172, 224
- injection time 540
- injection unit carriage 716
- in-mold labeled 628, 654
- in-mold labeling 86
- insert 291
- insert cooling 424, 431, 448
- inserted key 323
- inserted plug 447
- inserts 288
- inserts cracking 728
- inside center gate 55
- inside gating of caps 297
- inside projections 367
- insulated runner 480, 499, 500
- insulated runner molds 499
- insulated runners 10
- insulating bubble 718
- insulators 518
- interchangeable inserts 679
- interface points 234
- internally gated 447
- internal radius 49

- internal return springs 335
- internal spring 656
- internal springs 335
- internal threads 274
- interrupted (spot) vent 350
- intersections of rib 321
- intersections of runners 314
- inventory 514
- ion implantation 563
- iron housing 697
- ISO 4762-2004 574
- Izod impact strength 24

J

- jacking 712
- jacking holes 658
- jacking system 712
- jetting 107, 726
- jiggle pins 369
- Jo-blocks 237
- J-type 526

K

- knockout pads 316
- K-type 526

L

- labels 86
- laminar 410, 540
- laminar flow 401, 408, 507
- land 287, 318, 550
- land length guidelines 308
- large ejector pins 310
- large production 177
- laser engraving 110
- latches 233
- latch lock 700
- latch lock system 654
- latch lock systems 381
- layout of cooling lines 422
- lead angle 52, 568
- leader pin 247, 457
- leader pin bushings 341
- leader pins 253, 455, 477, 658
- leader pins and bushings 626
- lead test 712
- leakage 717
- legal implications 233
- length of land 317
- levers 383, 384

- lid 97
- lid mold 632
- lids 95, 298
- lifter 659, 694
- lifter insert 659
- Lifter Link™ 694
- lifters 369, 371, 373, 685, 689
- light-weighting 34, 135
- lime deposits 393
- links 383, 384
- liquid colorant 718
- live hinges 56
- living hinge 670
- living-hinge case 694
- load-carrying pads 281
- locating ring 220, 257
- locating the manifold 516
- locational clearance fits 102
- location of ejector pins 320
- locking angle 471
- locking taper 466
- lock ring 468, 666
- lock washers 578
- Loctite® 577, 579, 580
- logic controls 168
- long ejection stroke 335
- long heat up time 732
- lost-core molding 7
- lost motion 380, 383
- low-cost mold 245
- lowest product cost 206
- L/t ratio 46, 56, 637
- lubricants 23
- lubrication 384, 551

M

- machinability 252
- machine dry cycle 172, 183
- machine ejector 221, 664
- machine ejectors 325, 338
- machine hour cost 201, 230
- machine nozzle 479
- machine opening stroke 297
- machine platen 257, 325
- machine platen layout 233
- machinery steel 252
- machine specifications 220
- machining 556
- machinists 231
- magnet 719
- maintain the orientation 191
- male taper 467

- manifold 506, 520, 714
 - heaters 227
- manifold backing plate 520, 535
- manifold back-up support 519
- manifold heaters 538
- manifold plate 520
- manifold plate cooling 714
- manifold plate cutout 521
- manifold plate pocket 516
- manifold pocket 521
- manifold supports 518
- material hopper slide 715
- material-safe conditions 602
- material selection 285
- mating parts
 - hardness 563
- mating tapers 711
- M/C nozzle 519
- mechanical properties 757
- melt 223
 - temperatures 556
- melt channel size 541
- melt channel sizing 514
- melt delivery system 501
- MeltFlipper 495
- melt index 27
- melt temperature 150, 168, 172, 526, 540
- micro balls 238
- micro roller 238
- micro rollers 236
- mild steel 243
- mild steels 175, 243, 552
- milled grooves 431
- milled slots 433
- milling of the channels 511
- minimum number of cavities 230
- misalignment 453
- mismatch 78, 80
- model-based definition 582, 600
- modular cavities 435
- modular molds 282
- module 279
- modulus of elasticity 249, 281, 324, 554, 570
- moisture streaks 726
- mold
 - clamps 221
 - drawings 231
 - hardware 247
 - materials 389
 - mounting 221, 235
 - release agents 294
 - shoes 243
 - steels 549
- mold cooling 176, 387, 643
- mold cost 213
- mold cost per unit molded 204
- Moldex3D 400
- mold halves 7, 15
- molding cycle 158, 223, 481
- molding properties 753
- molding surface 428
- molding surface finish 84
- molding surfaces 82
- mold insert 110
- mold installation 333
- mold life 241
- mold manual 745
- mold materials 175
- Moldmax 654
- mold-open 188
- mold open time 172, 185
- mold plate 245
- mold protection 714
- Mold Saver 552
- mold shoe 245, 477
- mold shut height 308
- mold start-up procedure 714
- mold stroke 298
- mold temperature 394
- mold test 713
- mold tester 713
- mold test information 720
- mold testing 707
- mold test troubleshooting guide 723
- mold tolerances 601
- molecular weight (distribution) 18
- monomer 17
- mounting holes 256
- moving cavities 473
- moving cavity 68, 288, 384, 648
- moving-cavity 648
- moving-cavity ejection 384
- moving insert 373
- moving ring 358
- moving vent 288
- multi-cavity mold 475
- multi-cavity molds 189, 227, 472, 477, 545
- multi-material 14
- multiple ejection stroke 377
- multiple ejection strokes 191
- multiple tunnel gating 489
- multi-stage ejection 67, 381

N

nameplate 714
naturally balanced 512
naturally vented 660
natural vent 645
neck ring 363, 666
neck splits 363
needle bearings 384
negative draft 48
negative engraving 91
net shape part 5
Newtonian fluids 26
nickel-plated 556
nickel plating 562
nitriding 556, 562
noise 361
non-datum features 605, 607
non-Newtonian fluids 27, 493
no pre-load 627
notches 553
notching 430
notes on drawings 233
nozzle 517
nozzle radius 220
nozzles 527
nozzle skirts 521
nozzle support 519
nozzle tips 527, 538
NPT 417
nucleated polymers 19
nucleating agents 24
number of cavities 129, 227
number of gates 222
number of screws 571
Nylok™ 579

O

Ohm's law 523
one-piece cores 443
open blow slots 355
open gates 529
open nozzles 137
operating window 395
orientation 587
origin of measurement 585
O-ring 642
O-ring grooves 242
O-rings 353, 426, 427, 435, 440, 575
O-rings pinching 728
out of alignment 712
outside center gate 54

overcap 446, 447
overcap lid 626
overcaps 484
over-constrained alignment 476
overheads 202
oversize ejector 317
oversize pins 104
oxidizers 166
oxygen mask 692

P

pails 343
pallet 683
parallel 413
parallel cooling 412
parallels 250, 329
part cost 230
part dimensions too large 731
part dimensions too small 731
parting line 7, 11, 41, 102, 147, 267, 280, 447, 481, 618, 648, 682
parting line vent 645, 658
parting line venting 289
parting line vents 291, 640
parts do not stack 730
parts stick in cavity 729
parts stick to the core 729
path of least resistance 44, 106, 411, 441
permissible stress 570
perpendicularity tolerance 596
PET bottles 179
Petri dish 95
physical vapor deposition 563
PiD 538
PiD² 538
pieces per year 229
pillars 660
pinch points 709
pin heads 326
pinion 670, 677
pipe plugs 416
pipe threads 430
pitch spacing 522
pivots 384
P/L 41, 63, 267, 280, 483
plant environment 162
plant-wide machine hour cost 202
Plasdan 652, 682, 685, 689, 692, 697
plastic 17
plastic forks or spoons 43
plastic in tension 305
plastic inventory 505, 515

- plasticizers 23
- plasticizing capacity 132, 223
- plastic leakage 732
- Plastic Part Design for Injection Molding 34
- plastic part drawing 266
- plate deflection 250, 325, 571
- platens 14, 15
- platen size 220
- plates 330
- plate stiffness 327
- plate supports 234
- plate thickness 571
- plug gage 237
- plug lid 628
- plugs 417, 435
- pneumatic air piston 347
- pocket 521
- polarity of engraving 91
- polishability 246
- polishing 83, 556
- polymer orientation 20
- Poly-Ond™ 85
- poppet 351, 353, 358
- poppet ejection 351
- poppet stroke 352
- position tolerance 596
- positive engraving 91
- positive return 328
- post-mold cooling 179
- post-molding operations 69
- potato chip 425, 644
- potato-chipping 98
- power consumption 227
- power failure 226
- power supply 168
- power terminals 525
- power tool housing 657
- PPAP 722
- precedents 2
- preferred number 227
- preferred numbers of cavities 230
- preform 665
- preforms 470
- pre-hardened machinery steels 552
- pre-hardened mold steels 561
- pre-hardened plate steel 163
- pre-hardened steels 558
- preload 234, 273, 278, 340, 470, 471, 474, 571, 698
- preload distance 470
- preloaded 338
- preload force 470
- preloading 270

- preload of screws 569
- preloads 286, 461
- preload stresses 475
- premature hobbing 728
- press-fit 255, 444
- pressure differential 401
- pressure drop 121, 403, 505, 507, 514, 540
- pre-wired 501
- primary datum 610
- primary parting line 268
- product cost 207
- product hanging 305
- product identification 109
- production 219
- production mold 158
- productivity 223, 293, 299, 431
- product strength 110, 111
- products with bosses 440
- profile of a surface 596
- projected area 222, 279
- projection 484
- projections 272
- proper PPE 716
- protection of the cores 459
- prototype molds 155
- protruding gate mark 112
- protrusion 61
- proximity switches 682
- pry slots 246
- pseudo-plastic behavior 26
- pulling force 313
- pull ring 42
- purge guards 719
- push-pull ejection 333, 684

Q

- quality of materials 559
- quantity of cooling water 407
- quenching 561
- quick mold change 221

R

- racetrack filling 48
- race-tracking 98
- rack 375, 670, 677
- rack and pinion 375
- radiation 391, 395
- radii 240
- raised lettering 89
- random copolymer 19

ratchets 677
rate of heat 397
razor 55
reaming 322
rear-mounted 642, 650
recessed gate 61
record grooves 107, 726
rectangular box 673
rectangular container 654
rectangular trays 98
re-entrant 648
re-entrant angle 312
re-entrant bottom 648
reference dimension 239
regrinding 481
reinforcements 23
reliability 151
replaceable inserts 681
required clamp size 120
required cooling 167
required water flow 408
requirements 219
residence time 294, 544
resin 540
resistance heaters 168, 523
“resistance” wire 523
restoring preload 474
restrictors 415
retainer plate 331
retract 270
retractable core 275
retractable core inserts 688
return pin 323, 329
return pins 328, 332, 380, 615, 618
return springs 333, 384
Reynolds number 401, 402
rheological history 493
rheology 25
rheometer 27
rib on the bottom 648
ribs 49, 68, 182, 274, 291, 305–307, 321, 363, 658, 684
ribs and bosses 306
rim 308, 425, 632
rims 321
rim shapes 309
ring gage 237
ring grooves 433
ripples 107
ripples in the parts 729
risers 435
robot 295
robots 191, 378, 551

Rohr retractable core 687
rolled threads 568
roller 237
rollers 270
rotating core 670
rotation of the core 375
round taper pins 456
round tapers 462
runner 313, 479, 484
– mold 234
Runner and Gating Design Handbook 501
runner extension 488
runner puller 311
runners 479
runner system 392

S

safe 5
safe joint 579
safety 295, 361, 380
safety clothing 719
safety factor 553
safety gate 294
sand-blasted 85
scratches 242
screw caps 367, 484
screw design 136
screw drive 391
screw engagement 576
screw head 576
screw-in nozzle 528
screw-in nozzles 528
screw-in nozzle sealing 518
screw joint 572
screw pitch 566
screw pull-back 530
screws 234, 247, 473, 565
screw-sleeve arrangements 379
screw start 715
screw temperature 573
sealing 426
sealing force 519
sealing nozzles 528
secondary parting line 269
secondary parting lines 270
section modulus 251
self-cleaning venting 315
self-cleaning vents 287, 304
self-degating 481, 485, 487
self-locking 471
self-lubricating bushings 627
self-tapping screws 113

- semi-automatic ejection 294
- separating force 279
- sequence of operation 233
- sequential valve gate 681
- series cooling 412, 414
- servo motors 675
- set screws 578
- setup sheet 715
- shallow part 463
- shallow parts 626
- shank diameter 569
- sharp corner 50, 485
- sharp corners 242
- sharp edge 310, 645
- shear 304, 551
- shear heat history 507
- shear heating 540
- shear history 495, 508
- shear-induced balance 495
- shearing the plastic 310
- shear rate 514
- shear-sensitive 30, 668
- shear-sensitive materials 493
- shear stress 27, 321, 540
- shear viscosity curve 27
- shim 653
- shimming 463
- shocks 579
- shooting pot 391
- short lands 484
- shorts 287
- short screws 580
- short shots 730
- shot size 128, 223, 716
- shoulder bolts 379
- shoulder screws 577
- shrink 405
- shrinkage 20, 73, 266, 424
- shrinkage factor 99
- shrinking 389, 540
- shut height 221, 249, 435, 503
- shut-off 280
- shut-off area 280
- shut-off areas 280
- shut-off faces 710
- shut-off nozzles 139
- side core retract 685
- side core retractions 679
- side cores 62, 63, 222, 270–272, 279
- side draft 300
- side forces 270
- side interlocks 456, 459, 615, 623, 650, 662, 679
- side wall 272
- sidewall windows 52, 53
- significant cross-section 232
- significant undercuts 363
- silica 524
- silicon spray 552
- sine bar 670
- single acting air poppet 352
- single-cavity molds 481
- single-level molds 299
- single-piece cores 443
- single-spiral layout 431
- single-stage ejection 378
- sink 51
- sink marks 411, 731
- sink marks far from the gate 725
- sink marks near the gate 725
- sinks 51, 53, 99, 100, 287
- skirt 629
- sleeve 379, 660
- sleeve ejector 671
- sleeve ejectors 306, 308
- sleeves 247, 411
- slender core pins 411
- slender cores 286, 555
- slide 658
- slider 372, 682
- sliders 371, 663
- slides 253, 668
- sliding fit 343
- sliding nozzle sealing 517
- slot gate 537
- slots 274
- slow color change 732
- slug 488
- small cores 441
- smaller strippers 345
- small gates 484
- small production 177
- small vestige 485
- Smith, Don 613, 657
- snap 273
- snap feature 273
- snap-on lids 425
- snap rim 273
- snap ring 345, 353
- snap ring grooves 242
- snaps 114
- socket head cap screws 565
- solid bosses 305
- spacers 653
- spares 110
- special fits 73

- special mold shoes 245
- special screws 573
- specific density 401
- specific viscosity 401
- specific volume 753
- specifying a hot runner 505
- specks 726
- speed control 378
- SPI 221
- spigot 642
- spigotted 465
- spiral 433
- spiral cooling 700
- spiral grooves 433
- splay 107, 726
- split cavities 8, 272, 299, 664
- split cavity 362, 664, 690, 699
- split-cavity 374
- SPLIT cavity 697
- split lines 270, 272
- splits 62, 270, 367
- spools 367
- spring 654
- spring loaded 658
- spring loaded insert 654
- springs 351, 554
- spring washers 578
- sprue 479
- sprue bar won't heat 732
- sprue bushing 714
- stack 243, 278
 - layout 267
 - molds 552
- stack alignment 455, 456
- stack compression 280, 281
- stack construction 286
- stack height 75
- stacking clearances 77
- stacking height 70, 75, 282
- stacking lugs 75, 93
- stacking of products 74
- stacking shoulders 48
- stack molds 8, 297, 299
- stack parts 429
- stack sizing 278
- StackTeck Systems 628, 649, 665, 674
- stadium cup 640
- stagnant coolant 409
- stagnation 508
- stainless steel 164, 244
- stainless steels 252, 556, 559
- stainless steel screws 575
- standard geometrical tolerancing 102
- standardizing 561
- standard mold sets 330
- standard mold shoes 243
- standard NPT 417
- standard pipe thread 416
- standard size 318
- standard sizes 330
- standard wedge locks 456
- start up 392
- start-up 299
- star washers 578
- static seals 426
- stationary platen 8
- stationary vent 288
- stationary vents 287
- steady state 394
- steady-state 395
- steady-state conductive heat transfer 399
- steady-state temperature 393
- steel part drawing 37, 266
- steels 549
- steel-safe dimensions 73
- steel sizes 219
- steel structure 560
- stepped P/L 269
- stickiness 379
- stiffness 249
- stop buttons 325, 332, 343, 659
- straight interlocks 658
- straight P/L 268
- straight-walled product 300
- strain-harden 665
- streaks 725
- strength of material 551
- strength of the screw joint 575
- strengths of materials 249
- stress 250, 251
- stress concentration 240
- stress-cracking 240
- stresses 249, 429
- stress in the cavities 283
- stress raisers 416
- stress whitening 726
- stringing 532
- stripped ejection 64
- stripper 379
- stripper bar ejection 347
- stripper bars 341, 346, 663
- stripper bolts 577
- stripper ejection 338
- stripper guides 342
- stripper inserts 343
- stripper molds 377

stripper plate 293, 313, 329, 338, 342, 376,
621, 632, 650, 654, 663, 670
stripper plates 313
stripper retainer bolts 335
stripper ring 309, 310, 340, 360, 447, 468, 621,
626, 629, 645, 654, 676, 688, 700
stripper ring ejection 643
stripper ring float 345
stripper rings 341, 343, 348, 473, 551, 644,
650
strippers 338
stripper sleeve 671, 676, 690
stripper sticks 731
stripping 273
stripping force 343
stroke 299
stroke limiter 255, 256, 342
stroke limiters 256, 333, 342, 347, 386, 632,
708
stroking core air 357
stroking poppet 351
submarine gates 615
submarine tunnel gating 489
sub-runners 494
sucker pin 615
sucker pins 312, 313
suckers 312
superstructure 670, 677
supplying water 452
support 518, 520, 521
support pillars 250, 253, 329, 646, 681
surface definition 149, 150, 506
surface finish 81, 84, 553
surface finish forces 301
surface roughness 301, 302
surface treatments 562
synchro plate 536

T

take-off 295
take-off plate 297
take-offs 297
tamper-evident bands 69
tamper-evident skirt 654
tap drill sizes 417
taper alignment 476
taper backing-up 375
tapered extensions 488
tapered plug 443
tapered shut-off 340, 535
taper fits 473
taper lock 456, 472

taper locks 552
taper pin 459
tapers 343, 473, 474
– external 237
– internal 237
taper wear 727
T/C 526
teeth 677
temperature 396
temperature controls 538
temperature differences 411
temperature drop 392
tensile (or compressive) strength 554
tensile strength 24, 324, 757
tension 550
TEP 151, 201
terminals 524
tertiary branches 494
tertiary datum 604, 606, 607, 609, 610
testing 707
texturing 85
thermal conductivity 172, 389, 392, 399, 400,
556
thermal cycling 530
thermal expansion 453, 473, 517, 518, 556,
603, 755
thermal properties 761
thermocouples 227, 520, 526
thermodynamics 388, 395
thermolator 391
thermoplastics 17
thermosets 17
thick cross-section 660
thickness variations 455
thick products 440
thick to thin 53
thick-walled products 178
thin-walled 286
thin-walled containers 281
thin-walled products 251, 426, 434
thin-wall molding 61
thread 670
threaded shank 567
thread engagement 575
thread pitch 64, 566
thread profile 64, 649
thread runouts 64
threads 62, 64, 367
three-plate gates 490
three-plate molds 483
tie bar 233
– clearances 220
timing 378

- title block 235
- toe-in 426
- toeing-in 425
- toggle lock 338
- tolerance accumulation 589, 597
- tolerance build-up 710
- tolerances 2, 70, 72, 218, 219, 462, 475
- tolerancing 581, 601
- tonnage blocks 280, 682, 689
- tons of refrigeration 406
- tooling hole 239
- tool steels 558
- toothbrush 55
- torsion 551
- total cost of the machine 202
- total stress 570
- toughness 551, 555
- transient mode 393
- trapezoidal vent groove 289
- tray 98
- troubleshooting 723
- T-seals 353
- tube 623
- tubular bosses 307
- tubular heaters 523, 524
- tumbler 643
- tungsten-carbides 281
- tungsten disulfide 563
- tunnel-gated 621
- tunnel gates 487
- turbulent 410
- turbulent flow 401, 408
- two-piece core 444
- two-plate cold runner system 479
- two-plate mold 481
- two-plate molds 481, 487
- two-stage ejection 68, 274, 288, 378, 654
- two-stage ejector pin system 379
- two-stage stripper ring 655
- types of runners 480

U

- ultimate and yield strength 554
- undercut 52, 63, 273, 362, 371, 687
- undercuts 62, 64, 68, 85, 272, 274, 297, 324, 363, 369, 374, 378, 649, 659, 663, 685
- undercuts of the thread 364
- undercuts on the core 274
- uneven fill 731
- uneven shear history 497
- uniform shrinkage 266
- uniform wall thickness 43, 174

- universal mold shoes 160, 245
- unscrewed 274
- unscrewing 64, 551, 574
- unscrewing ejection 674
- unscrewing mold 65, 67
- unscrewing molds 369, 375
- up and down 8
- uptime 151
- UV stabilizers 24

V

- vacuum 291, 300, 384
- vacuum in the cavity 347
- valved gates 60
- valve gate 616, 668
- valve-gated molds 715
- valve gate pistons 535
- valve gates 529, 533, 662
- valves 536
- vapor-honed 85
- variable shrinkage 22
- velocity 401
- vent 668, 683
- vent channel 290, 291
- vent channels 289
- vent groove 290
- vent grooves 287, 289, 638
- venting 60, 68, 182, 287, 291, 300, 307, 319, 351, 439, 616
- venting inserts 681
- vent pin 290, 447
- vent pins 288, 291, 315, 440
- vent pin vents 290
- vents 288, 308
- vent sizing 289
- vent slots 440
- vertical free fall 299
- vertical split 272
- Vespe[®] 718
- vestige 338, 484, 486, 488
- vial 621
- vials 489
- vibrations 579
- views 231, 234
- virgin plastics 503
- viscosity 26, 150, 401, 403, 493, 540
- viscous 540
- voids 51, 53, 59, 60, 99–101, 727, 731
- voltage 523
- volume of coolant 165
- volumetric shrinkage 491
- VSM 51100 417

W

wall thickness 150, 174, 456, 540
warpage 53, 491, 731
water absorption 753
water lines 632
water temperatures 393
wattage 420
watts 523
W drilling 664
wear 438, 474, 551, 555
wear ring 467, 638
wedge 347, 473
– action 551
wedge lock 456, 459, 656
wedge locks 463
wedges 455, 474, 552, 653, 698
wedging action 430
welded in 444
welding 557, 560

weld line 115, 694
weld lines 53, 58, 60, 105, 106, 287, 486, 663,
726
where to eject 303
wire channels 520
witness line 310, 438, 443, 444
witness lines 101, 316
working tapers 474
wrenches 577
wrench size 430

Y

yield 151
yield strength 24, 249, 553, 570, 573

Z

zigzag lines 447