


HANSER

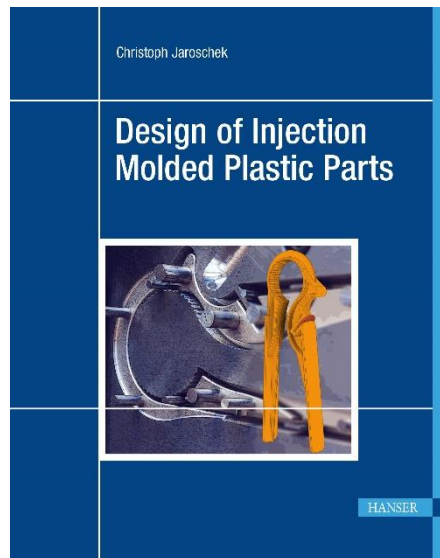

Sample Pages

Design of Injection Molded Plastic Parts

Christoph Jaroschek

ISBN (Book): 978-1-56990-893-8

ISBN (E-Book): 978-1-56990-894-5

For further information and order see

www.hanserpublications.com (in the Americas)

www.hanser-fachbuch.de (outside the Americas)

© Carl Hanser Verlag, München

The Author



Prof. Dr. Christoph Jaroschek studied mechanical engineering, and was then Head of Application Technology and Process Development at a well-known manufacturer of injection molding machines for 11 years. Since 1998 he has held the position of Professor in Plastics Processing, in the area of Engineering Science and Mathematics, at the Bielefeld University of Applied Sciences, Germany.

Preface

Many designers are nervous when the material requirement for a development task is a plastic. One reason also lies in the education system or the level of knowledge of the instructors and professors. Until about 1990, the world consumption of plastics was still smaller than the consumption of steels (Figure 1). The volume, not the weight, is used as a benchmark here. If one compares the two groups of materials, volume is a suitable parameter regarding a design, as it is not the weight but the size (i.e. the volume) that is important, especially in the case of plastic components.

Demand for plastics is growing faster than the increase in knowledge among design engineers

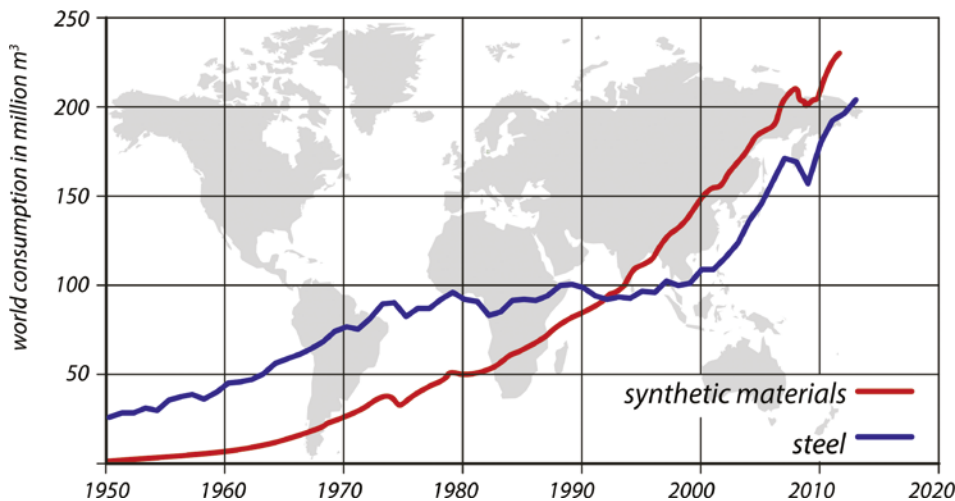


Figure 1 Temporal development of the demand for steel and plastics [Data sources: World steel assoc., PlasticsEurope Deutschland e.V.]

Before 1990, part design was mainly for metal materials and the importance of plastics was still limited in the training of design engineers. Today, the picture has changed significantly, but it still takes time for training to adapt accordingly.

Dimensioning and calculation	Many books about plastic design have been written by proven experts in the field of plastics themselves. In many cases, the focus is on the calculation or dimensioning of components, rather than on their design. This is where this book comes in.
Injection moldable design	Since most plastic components only must withstand low loads, the actual design of the component is more important than the mechanical design in many applications. It is important to know that most plastic components are injection molded. Therefore, a designer should know first and foremost what this means for the design. This book focuses on the area of injection molds. The designer should be aware that his design specifications must ultimately be implemented with an injection mold. In this book, the focus is on the field of injection molds. The designer should be aware that his design specifications must ultimately be implemented with an injection molding tool.
Plastics in the following are synonymous with thermoplastics	Due to the focus on injection molded parts, thermoplastics are mainly treated here. These are plastics that melt at higher temperatures. For simplicity's sake, the term plastic is therefore used synonymously for thermoplastics in the following, unless otherwise noted.
Literature	In many places, the content of this book is perhaps a little concise. The book is initially intended to show the important relationships so that the designer understands why the design of injection molded parts must be different from that of metal parts. Many specific details have deliberately not been formulated. This applies, for example, to information on draft angles or radii. Plastics of even one grade (e.g. PP) are available in an almost unmanageable variety with regard to mechanical properties. The properties mentioned here concern, among other things, the mechanical stability under load. Here, a designer should not rely on recommendations from tables but rather consider what effects a too small/large radius, for example, will have for a component. This book is therefore particularly focused on understanding, so that the concrete specifications can be sensibly selected for the respective application. The compilation of the necessary knowledge for the designer in this book draws on existing literature. ■ <i>Process knowledge</i> ■ W. Michaeli, H. Greif, G. Kretzschmar, F. Ehrig, <i>Training in Injection Molding</i>, Hanser ■ G. Pötsch, W. Michaeli, <i>Injection Molding</i>, Hanser ■ T. A. Osswald, L.-S. Turng, P. Gramann, <i>Injection Molding Handbook</i>, Hanser ■ S. Kulkarni, <i>Robust Process Development and Scientific Molding</i>, Hanser

- *Mold engineering*
 - G. Menges, W. Michaeli, P. Mohren, *How to Make Injection Molds*, Hanser
 - F. Johannaber, *Injection Molding Machines*, Hanser
- *Design*
 - H. Rees, *Understanding Injection Mold Design*, Hanser
 - B. Catoen, H. Rees, *Injection Mold Design Handbook*, Hanser
 - R. A. Malloy, *Plastic Part Design for Injection Molding*, Hanser
- *Material knowledge*
 - G. W. Ehrenstein, *Polymeric Materials*, Hanser
 - T. A. Osswald, G. Menges, *Materials Science of Polymers for Engineers*, Hanser

Contents

The Author	V
Preface	VII
1 Plastic Parts	1
1.1 General Information	1
1.1.1 Comparison of Designs (Conventional vs. Plastic)	2
1.1.2 Special Features of Plastics	4
1.1.2.1 Comparison of the Properties of Plastics and Metals	5
1.1.2.2 Special Mechanical Behavior	6
1.1.3 Reasons for Using Plastics	11
1.2 Design Rules	14
1.2.1 Special Design Features of Injection Molded Parts	16
1.2.1.1 Demoldability	16
1.2.1.2 Flow Path to Wall Thickness Ratio	22
1.2.1.3 Sprue Position	23
1.2.1.4 Avoiding Material Accumulation, Thin Wall Thickness ..	24
1.2.1.5 Stiffeners	25
1.2.1.6 Dimensional Change due to Temperature Fluctuations ..	28
1.3 Dimensional Deviations between CAD and Injection Molded Part	28
1.3.1 Shrinkage	28
1.3.2 Warpage	32
1.3.3 Corrective Measures for Dimensional Deviations	33
1.4 Design of Connections	37
1.4.1 Screw Fasteners	38

1.4.2	Snap-Fit Connections	40
1.4.3	Bonding and Welding of Seams	42
1.4.3.1	Adhesive-Bonded Joints	42
1.4.3.2	Welded Joints	44
1.4.3.3	Film Hinges	47
1.5	Tolerances and Dimensions	49
1.6	Sizing	54
2	The Injection Molding Manufacturing Process	57
2.1	The Process and What the Designer Should Know	57
2.1.1	Flow Path Lengths Are Limited	58
2.1.2	Molded Part Area Determines Machine Size	60
2.1.3	Wall Thicknesses Determine the Cooling Time	61
2.1.4	Plastic Shrinks as It Cools	62
2.2	Influence of the Process on Component Properties	63
2.2.1	Weld Lines, Meld Lines	64
2.2.2	Surface Quality	65
2.3	Fiber Orientations Influence the Component Dimensions	67
2.4	Forward-Looking Quality Assurance	69
2.4.1	Sink Marks	69
2.4.2	Jetting	70
2.4.3	Diesel Effect	71
2.4.4	Incomplete Filling, Burr Formation, and Deformation during Demolding	72
2.5	Special Injection Molding Techniques	73
2.5.1	Multi-Component Technology	74
2.5.1.1	General Procedure	75
2.5.1.2	Molding Techniques	76
2.5.1.3	Component Design	79
2.5.2	Fluid Injection Technology (FIT)	85
2.5.2.1	Processes	87
2.5.2.2	Component Design	91

3	Molds	97
3.1	General Tasks and Functions	98
3.2	Manufacture and Costs	100
3.2.1	General Machining	101
3.2.2	Surfaces	103
3.2.2.1	EDM – Electrical Discharge Machining	104
3.2.2.2	Etching	105
3.2.2.3	Laser Texturing	106
3.2.2.4	Ceramic Surfaces	107
3.2.3	Steels	108
3.3	Standard Elements	112
3.4	Melt Feed	116
3.4.1	Cold Runners	118
3.4.1.1	Cavity Layout	119
3.4.1.2	Gating to Cavities	121
3.4.1.3	Demolding of the Runner System	124
3.4.2	Mold with Pre-Chamber Nozzle	126
3.4.3	Insulating Channels	127
3.4.4	Hot Runners	129
3.4.4.1	Internally Heated Systems	131
3.4.4.2	Externally Heated Systems	131
3.4.4.3	Hot Runner Nozzles	132
3.4.4.4	Cascade Technology	135
3.5	Temperature Control	136
3.5.1	Concepts for Temperature Control	141
3.5.1.1	Continuous Flow Temperature Control	141
3.5.1.2	Pulse Cooling/Discontinuous Temperature Control	143
3.5.1.3	Variothermal or Intermittent Temperature Control	143
3.5.2	Implementation	145
3.6	Demolding	149
3.6.1	Straight-Line Demolding in the Axial Direction of the Opening Movement	150

3.6.2	Demolding of Contour Areas That Are Not Parallel with the Opening Movement	154
3.6.3	Demolding of Internal Undercuts	156
3.6.4	Demolding of Internal Threads	158
3.7	Increasing Efficiency with Two Parting Planes	159
3.7.1	Stack Molds	160
3.7.2	Tandem Molds	161
3.7.3	Design Features of Stack and Tandem Molds	165
3.7.4	Hot Runner Technology for Stack and Tandem Molds	168
4	Simulation	171
4.1	Goals of Simulation	173
4.1.1	Filling Simulation (Rheological Simulation) for Good Surfaces ..	173
4.1.2	Warpage Prediction	175
4.1.3	Heat-Flux Analysis	177
4.1.4	Calculation of Mechanical Stability (Structural Mechanics)	178
4.2	Base Models for the Rheological Simulation	178
4.2.1	Shape Models	179
4.2.2	Calculation Models	183
4.2.3	Material Models	185
4.3	Examples and Calculation Results	186
4.3.1	Filling Behavior	186
4.3.2	Holding Pressure Phase	189
4.3.3	Warpage	191
5	Material Selection	193
5.1	Usual Procedure for Selecting Materials	193
5.1.1	Selection Criterion: Temperature	194
5.1.2	Selection Criterion: Chemical Load	195
5.1.3	Selection Criterion: Mechanical Load	195
5.1.4	Selection Criterion: Special Requirement	197
5.1.5	Databases	198

5.2	Important Characteristic Values	202
5.2.1	Characteristic Temperatures	202
5.2.1.1	Glass Transition Temperature	202
5.2.1.2	Melting Temperature	203
5.2.1.3	Degradation Temperature	203
5.2.2	Heat Deflection Temperature	204
5.2.3	Continuous Service Temperature	206
5.2.4	Young's Modulus and Creep Modulus	208
5.2.5	Temperature Function of Young's Modulus	212
5.3	Limits on Mechanical Design	214
5.3.1	Short-Term Loads	214
5.3.2	Long-Term Loads	215
5.3.3	Estimation of Design Limits Using Reduction Factors	216
Index		219

This chapter compares the special features of plastic parts with alternatives made of metal or other materials. There are design rules that are directly justified by the manufacturing process. The information provided here is intended to give the designer a rough overview.

■ 1.1 General Information

Injection molded components differ from their metal counterparts in interesting ways.

Difference between
metal and plastic parts

- Plastic parts have a different shape for the same function.
- Often a conventional assembly can be realized in one plastic part, i. e. many functions can be implemented directly in a single component.

For example, consider compressor bars made of metal, plastic, and material combinations (Figure 1.1). First, it is important that the requirements are met. The question as to which material is better or worse is not possible until clear evaluation criteria have been established.



Figure 1.1 Metal and plastic compressor bars for ring binders

In any event, the requirements for the compressor bars are:

General requirements

- Function: Clamping force
- Economy (manufacturing costs).

The clamping force is generated by the deformation of a wire in the elastic range in the case of the metal variants and by the deformation of the plastic in the all-plastic variant. Due to the considerably lower modulus of elasticity of plastic, the plastic variant is only suitable for small forces and should not be used for very thick ring binders.

Manufacturing costs of injection molded parts are only favorable for large production runs

Manufacturing costs consist of the costs of material, production equipment (machine and mold) and labor. Roughly speaking, material costs constitute half of the manufacturing costs. Material costs range from 2 to 4 \$/kg. In the all-plastic variant, the costs are very low because the product is created in a single process step. Although the machine and tooling costs are very high, if the expected number of pieces exceeds the limit of about 10,000 the tooling costs per part are low. And if many injection molded parts can be produced per hour with one machine, the machine costs per part are also low.

Functional integration leads to simpler production

The metal compressor bars consist of several elements that must be joined together. Basically, the fewer process steps that are necessary, the lower is the risk of failure in production. This should also be considered when compiling manufacturing costs.

1.1.1 Comparison of Designs (Conventional vs. Plastic)

Rethinking the design when using plastics

The use of plastics requires a fundamental design rethink. The example of a clothespin shows that the older product made of wood is cheaper than a similar plastic clamp (Figure 1.2). Both variants consist of two clamp elements that are pressed together by a metal spring. The wooden clamp can be cut very quickly from a profile-milled board. The corresponding plastic clamp is more expensive to manufacture and has inferior properties, because it can become brittle and break due to weathering.

A well-designed plastic clamp will consist of only one element, and that eliminates the need for assembly. In principle, plastic components can incorporate many functions. This is referred to as functional integration.

Cast structures can have very freely formed surfaces

A plastic component can have a very complex design if it is manufactured by injection molding. Due to the molding process used for production, the design of a plastic component can feature any type of free-form surface. In conventional components, the individual parts are predominantly milled and turned from the solid, with the result that simple shapes predominate here.

Considering a comparison to conventional products, the following generalization can be made:

Conventional components often consist of various individual parts that form an assembly. By contrast, good plastic components often consist of a single part (Figure 1.3).

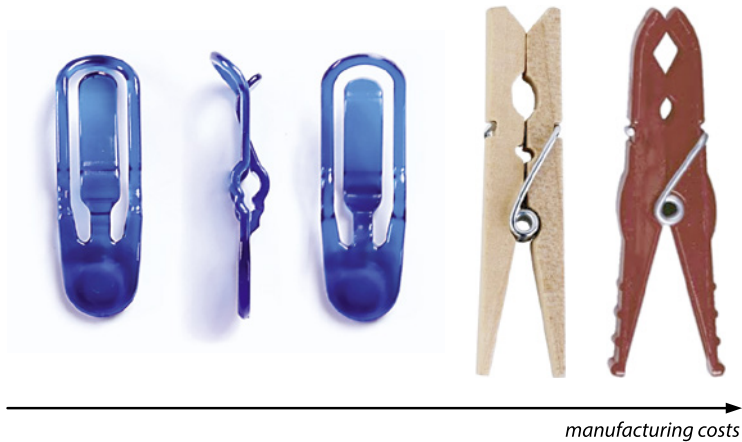


Figure 1.2 Manufacturing costs of clothespins of different designs

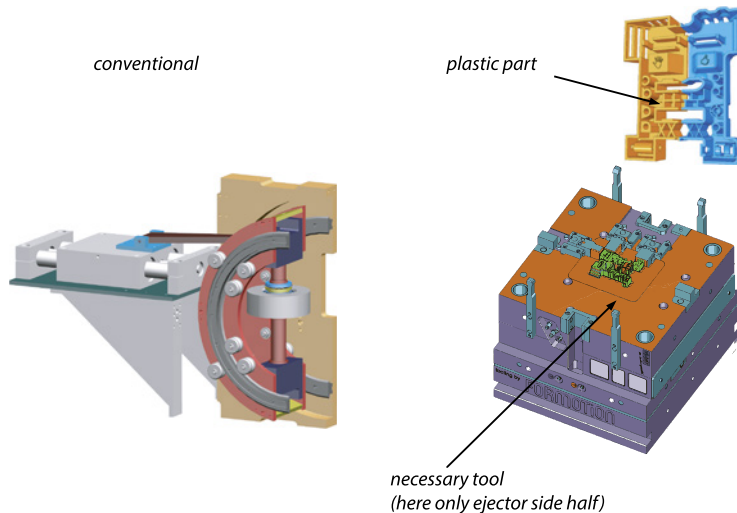


Figure 1.3 Comparison of a conventional assembly consisting of different individual parts and a plastic component, along with the mold required for production [image source: Ziebart/FH-Bielefeld, Ritter/HS-Reutlingen]

During the development of a plastic component, consideration must be given to the mold at the design stage, because it limits the design freedom to a certain extent. In any event, the designer of an injection molded part should be aware of the possibilities afforded by mold technology, because slight changes in the shape of a plastic component can have a very large effect on the cost of a mold. Molds consist of many individual parts and are in turn very complex assemblies. The molds must perform different tasks (Figure 1.4). The actual mold cavity has to be filled with melt and the heat of the melt needs to be dissipated (cooling) so that the plastic part will become solid and stable and can be demolded via an ejector system.

Good designs in plastic consider the feasibility of using injection molds

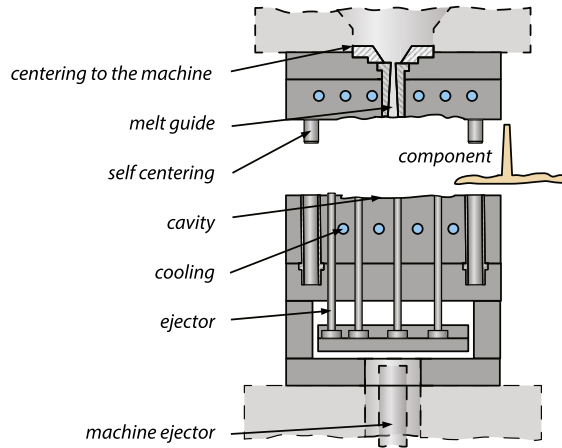


Figure 1.4
Design and functions of a simple injection mold

Demonstration mold shows effect of good component design on the mold

For demonstration purposes, the “Polyman” plastic component shown in Figure 1.3 is poorly designed on the left side and well-designed on the right side. This assessment of the design relates to the mold implementation. For the various lateral openings, three sliders are required on the poorly designed side to demold the undercuts (Figure 1.5). With a few minor changes to the shape, the well-designed side can dispense with sliders completely. This makes the mold less expensive and less susceptible to faults during production or requires less maintenance.

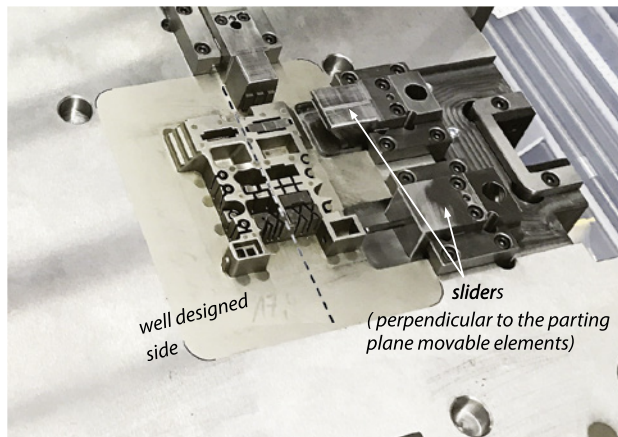


Figure 1.5
Ejector side for the Polyman demonstration part [image source: Ritter/HS-Reutlingen]

1.1.2 Special Features of Plastics

The biggest advantage of plastics is their low melting point

The most important property is the melting temperature of plastics, which is only about 1/10 that of metal (Figure 1.6). This makes it possible to cast plastics in steel molds of very complex shape. The precision of the steel molds can be transferred to

the plastic component largely without the need for reworking and can be repeated almost as often as required. However, the complexity and expense of such molds render this production barely suitable for small production quantities. Plastic parts manufacture is thus almost always a mass production process.

A distinction needs to be made between melt temperature and transition temperature. In processing, the melt temperature is always much higher than the transition temperature from the solid to the melt state. Strictly speaking, only semi-crystalline plastics can melt, because melting entails the liquefaction of crystalline areas. Amorphous plastics, therefore, merely soften. This may not become clear until Chapter 5, where specific material properties and characteristic temperatures are discussed.

Temperature of the plastic melt

1.1.2.1 Comparison of the Properties of Plastics and Metals

Further comparison with metals reveals major differences in properties. Thus, specific applications may only be feasible in one of the two materials.

Mechanical properties of plastics are not as good as those of metals

Table 1.1 Comparison of Metals and Plastics

Property	Metal	Plastics
Young's modulus	high	low
Tensile strength and yield strength	high	moderate
Density/weight	high	low
Young's modulus	no	possible

- The modulus of elasticity of metals and especially steels is approx. 1000 times higher than that of plastics. Applications subject to high load requirements are therefore largely limited to metals. Plastic components would deform too much in such cases.
- Metals are stronger than plastics. The issue here is that of component failure. This can be both a fracture and an unacceptable permanent deformation.
- Young's modulus and the strength of plastics are strongly dependent on temperature. For applications involving high temperatures, which can be as low as 50 °C, particular care must be exercised in the choice of material subject to long-term loads.
- The density of plastics is only approx. 1/7 that of steel. Applications that require a certain weight (e.g. pendulums for clocks or curtain weights) cannot easily be made in plastic.
- Some plastics are transparent.

Young's modulus for plastics is temperature-dependent and therefore not constant

A close comparison of different materials reveals further advantages and disadvantages.

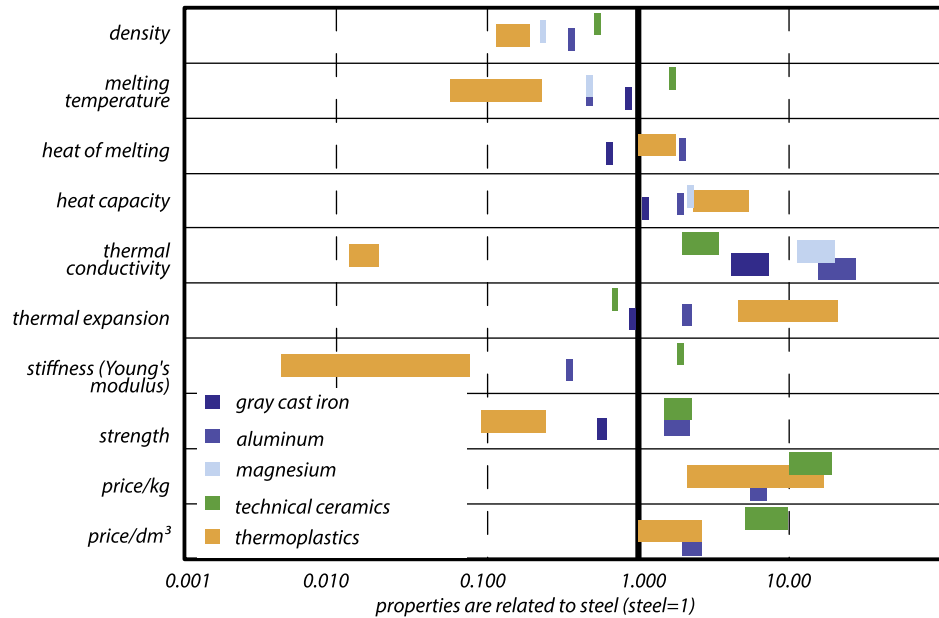


Figure 1.6 Comparison of thermoplastics with steel [source: WAK-Kunststofftechnik]

With regard to production, the low thermal conductivity of plastics makes it difficult initially to dissipate the heat of the melt from inside the component to the mold. The thicker a component is, the longer the cooling process will take. For this reason, plastic parts are thin-walled wherever possible. Jumps in wall thickness are unfavorable.

Low thermal conductivity enables precision injection molding of fine structures

The low thermal conductivity, however, also makes it possible to fill long, thin flow paths in a controlled manner. Plastic components can thus be considerably finer structured than cast metal components.

Plastics are usually more expensive per kg than metals

It is often assumed that plastics are inexpensive, but this is not the case. Especially those plastics that are intended for use at elevated temperatures can cost more than \$10 per kilogram. When expressed in terms of weight, the outcome is the specific raw material price, which is given in \$/kg. This is comparable to that of metals.

1.1.2.2 Special Mechanical Behavior

Metals have a definite failure limit (yield strength)

Metals are atomic in structure, i.e. they are composed of individual atoms that form crystals in regular repetition during cooling. When a load is applied, the atoms move slightly away from each other, returning to their original state after the load is removed. This elastic behavior is linear, i.e. the deformation increases in proportion to the load. Above a load limit R_p , entire atomic layers shift; when the load is removed, the deformation remains (Figure 1.7).

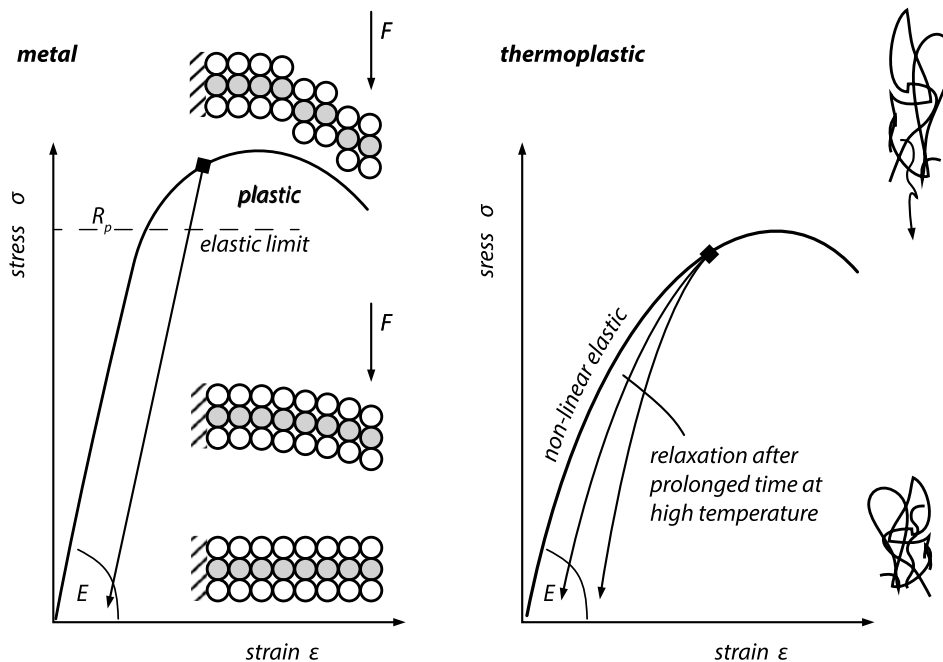


Figure 1.7 Elastic and plastic deformation of metals and plastics at different load levels

Plastics have a molecular structure, which can be imagined as a collection of tangled spaghetti. The entire tangle of molecules is initially elastic under load. At low temperatures, the molecular chains “stick” to each other; at higher temperatures, they are able to slide off each other. The deformation behavior is not linearly elastic, i.e. at high loads, the deformation becomes increasingly greater. The extent to which a load allows complete recovery of deformation depends strongly on its duration. A brief load is often elastic, while a load applied for a long time causes irreversible viscous deformation.

For accuracy, the deformation of plastics should not be called plastic, but viscous. Plastic deformation always describes an irreversible deformation; in metals, this occurs through the sliding of planes of regularly arranged atomic layers. Plastics, however, consist of tangled long molecules which, under load, can deform as a whole bundle and can partially recover their deformation. Viscous deformation is said to occur when the permanent deformation that cannot be recovered is time-dependent.

The different plastics each have a specific molecular structure. There are two groups (Figure 1.8): crosslinked and non-crosslinked. Thermosets and elastomers belong to the crosslinked plastics. During processing, chemical bonds form between the molecular chains, preventing them from melting even at high temperatures. The following pages deal almost exclusively with non-crosslinked

Mechanical failure of plastics is time- and temperature-dependent (viscous)

Difference between plastic and viscous deformation

Thermoplastics can soften or flow at higher temperatures

thermoplastics. A distinction is made between amorphous and semi-crystalline thermoplastics. Amorphous means that the molecular chains are entangled totally irregularly. In the case of semi-crystalline plastics, it is possible for some of the molecules to form regular arrangements in crystal form during the cooling process.

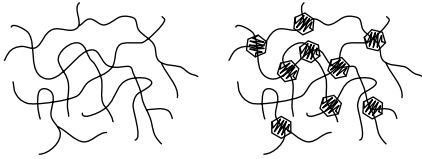
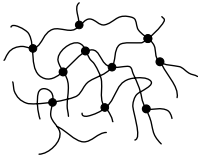
non-crosslinked plastics		cross-linked plastics	
amorphous	semi-crystalline		
			
loosely entangled molecules $T_{operation} < T_{glass}$ predominantly brittle at $T > T_{glass}$ plastic formable	entangled molecules and molecules linked by crystals $T_{operation} < T_{melt}$ at $T < T_{glass}$ brittle/elastic at $T > T_{glass}$ tough at $T > T_{melt}$ formable	molecules cross-linked, $T_{operation} < T_{degradation}$ predominantly brittle non-meltable	molecules cross-linked, soft intermediate segments, $T_{operation} < T_{degradation}$ at $T < T_{glass}$ brittle/elastic at $T > T_{glass}$ tough non-meltable
thermoplastics		thermosets	elastomers

Figure 1.8 Structure and application range of plastics

Below the glass transition temperature, plastics are mostly brittle and hard

All plastics have a characteristic glass transition temperature. Below this temperature, the behavior is largely glassy, i.e. brittle. The individual molecules of the plastic are virtually frozen and cannot be displaced against each other. Permanent deformation is not possible; the plastic behaves elastically. Above the glass transition temperature, the plastic softens increasingly, turning from tough to soft. Under load, permanent deformation occurs to an extent that depends on the temperature and the duration of the load.

Above the melting temperature, crystals of semi-crystalline plastics melt

Semi-crystalline plastics have an additional characteristic melting temperature above which the crystals melt. While amorphous plastics can only be used below the glass transition temperature because, above it, they undergo noticeable viscous deformation under load, semi-crystalline plastics can be used up to the melting temperature range. The crystals hold the molecules together. Compared to crosslinked plastics, the crystals act as physical crosslinking points.

The load-bearing capacity of plastics is temperature-dependent

Mechanical behavior is strongly dependent on temperature, especially in the case of thermoplastics (Figure 1.9). At very low temperatures, all plastics are predominantly brittle and break without warning like hardened steels (behavior 1, also characteristic of thermosets). In the glass transition temperature range, slight necking occurs shortly before fracture (behavior 2); unlike metals, the maximum

here is called the yield stress. Semi-crystalline plastics can deform extensively in the range between the glass transition temperature and the melting temperature. Very characteristic here is the shoulder-neck deformation (behavior 3). For actual applications, however, this behavior is of no further significance, because plastics should only be loaded up to their yield stress.

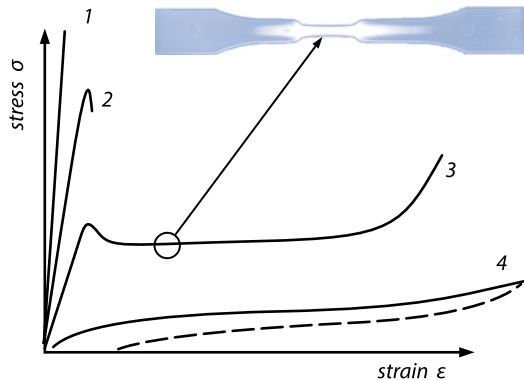


Figure 1.9 Deformation behavior of plastics under load

- 1: Thermoset or amorphous thermoplastic
- 2: Thermoplastic in the range of the glass transition temperature
- 3: Semi-crystalline thermoplastic above the glass transition temperature
- 4: Elastomer

It is interesting to note that semi-crystalline plastics in particular exhibit behaviors 1 to 3, depending on the operating temperature. Note that here the slope of the stress-strain curve becomes increasingly flat with increase in temperature, i.e. Young's modulus becomes smaller with increase in temperature.

The molecular structure influences the glass transition temperature and, in the case of semi-crystalline plastics, the melting temperature. The heat deflection temperature characterizes the temperature up to which a plastic component still largely preserves its shape under load. This property is closely related to the raw material price (Figure 1.10).

Plastics for high-temperature use are more expensive

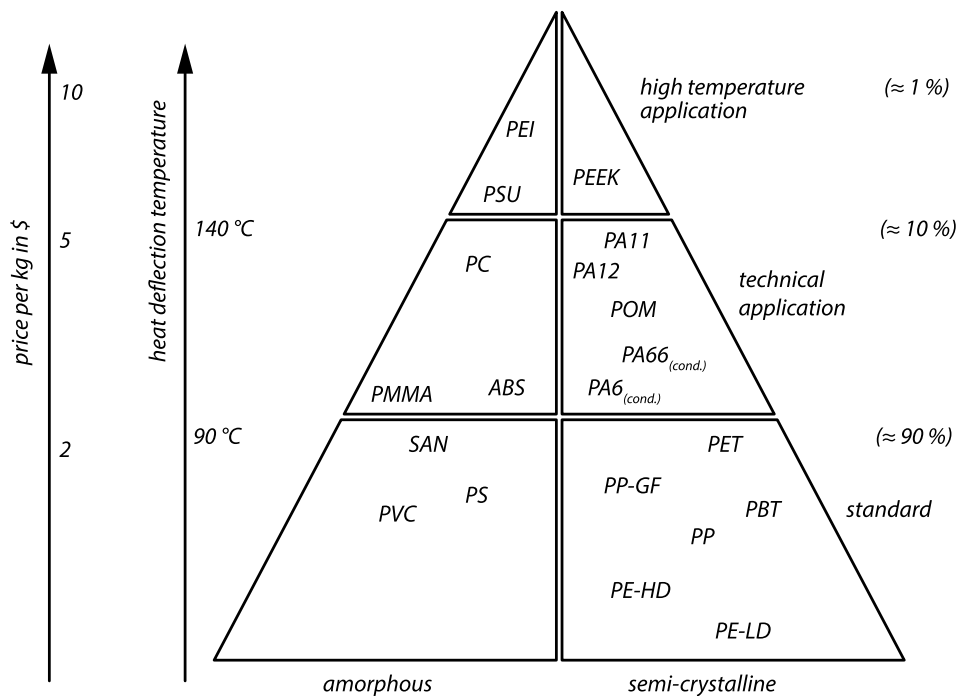


Figure 1.10 Important amorphous and semi-crystalline thermoplastics

The most important plastics are PP, PE, PVC

Even though there are very many different plastics, only a very few grades are used (Figure 1.11), with PP and PE playing a major role. This is because the properties of plastics can be modified within wide limits by means of fillers. This largely applies to stiffness (Young's modulus), which can be increased with glass fibers, for example.

Engineering plastics of high heat resistance are mainly used in the automotive sector.

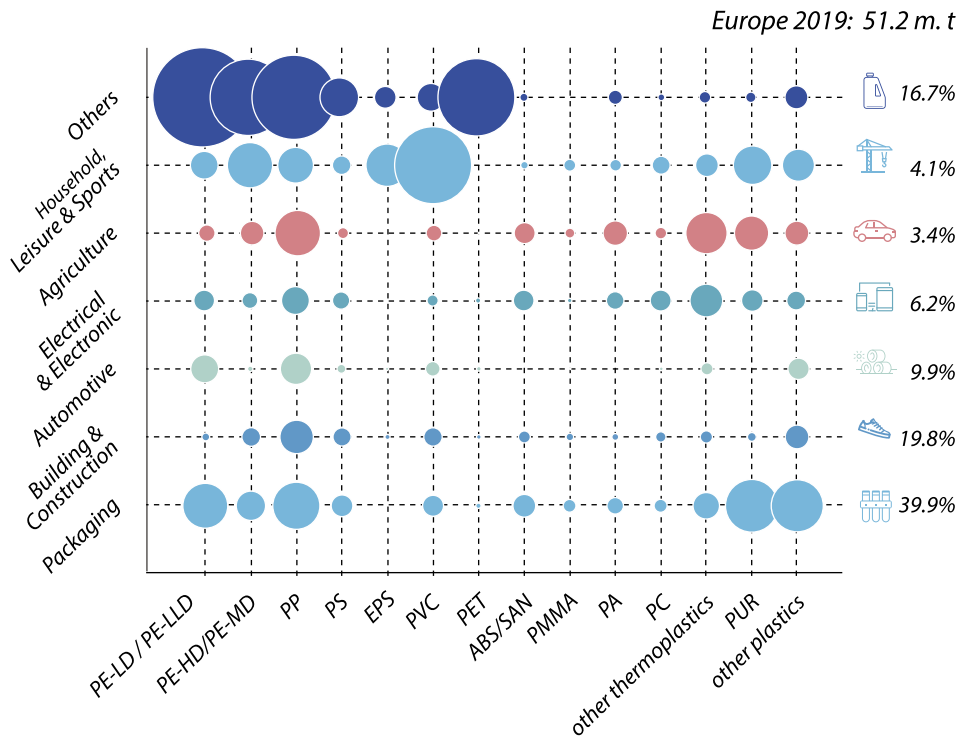


Figure 1.11 Predominantly used plastics by application [source: PlasticsEurope]

1.1.3 Reasons for Using Plastics

Plastics are chosen for a variety of reasons:

- Cost-effective reproduction
- Functional integration
- Material substitution
- Special properties
- Design
- Weight savings

Cost-effective reproduction means mass production. The cost of a single injection-molded component is very high because it cannot be produced without a suitable mold. Injection molds can be very expensive, with the price also depending on the complexity of the component to be produced. Complex components made of plastic are therefore always mass-produced items because the mold costs are spread over many components. Injection molding becomes an interesting proposi-

Mass production requires cost-effective, repeatable production

Index

Symbols

1D-meshing 179

A

actuated valve gate nozzles 134

air ejector 154

angled bolt 154

anti-rotation protection 151

B

balancing 117

blow-out method 90

burr formation 72

C

calculation model 179

cascade technology 135

cavity 99

cavity insert 98

centering elements 114

ceramic surfaces 107

Charpy 200

chemical load 195

clamping force 60

– necessary 100

closing wedge 155

coefficient of linear thermal expansion
62

cold runner 118

collapsible core 158

component dimensions

– mold-specific or non-mold-specific 51

compression volume 128

conical bucket gate 122

continuous flow temperature control
141

continuous service temperature 206

cooling

– channel 138

– CO₂ 143

– error 140

– time 61

core back technology 78

core pull 155

crazes 215

creep modulus 210

cycle time 61, 164

D

databases 198

degradation temperature 203

demolding 149

design limits 214

diesel effect 71

DIN 16742 49

E

EDM, electrical discharge machining
104

ejector pins 150

ejector plate 111

ejector protection 149
 ESR quality 111
 etching 105

F

family application 160
 fiber orientations 67, 68
 FIT 85
 flow cross-section
 – runner 120
 flow path length 59
 fluid injection technology 85
 fluid injector 89
 fountain flow 68

G

gas injector 89
 gate 116
 gating 121
 GIT 85
 glass temperature 200
 glass transition temperature 200, 202
 graphical fill image determination 174
 guide bushes 114

H

Hagen-Poiseuille 173
 HDT 204
 heat deflection temperature 204
 heat-flux analysis 177
 heel blocks 115
 hot runner 129
 – externally heated 131
 – internally heated 131
 H-shaped runner system 119

I

inclined slider 115
 induction heating 144
 insulating channel 127

internal undercut 156
 isochronous stress-strain diagrams 209

J

jetting 70
 joints
 – movable, overmolding 84

L

laser sintering 147
 laser texturing 106
 loss modulus 213

M

manufacturing costs 2
 material model 185
 mechanical load 195
 meld lines 64
 melting temperature 203
 meshing 179
 MFI 199
 midplane mesh 180
 moisture absorption 209
 mold installation height 97
 multi-component technology 74
 MVR 199

N

nozzle
 – needle valve 134
 – open 133
 – with tip 133
 number of cavities 100

O

opening width 125
 overmolding 74

P

PM steels 111
polishing 109
pre-chamber nozzle 126
preform 75
projected area 60
pulse cooling 143

Q

quasi-steady 137

R

reduction factors 216
rheological simulation 172
rotary technique 77

S

sandwich molding 74
secant modulus 208
shear edges 99
shrinkage 200
side cavity method 90
side cavity process 96
single point data 199
sink marks 69
slider 154
specification sheet 171
specific volume 62
spiral core 146
spotting 103
sprue
– bar, channel, runner system 116
sprue bar retainer 124
stack mold 159
standard mold 98
standard parts 112
star-shaped runner system 119

STEP 179

storage modulus 212
stripper plate mold 152
structural mechanics 178
surface finishing 103
surface net 181

T

tandem mold 160
temperature control 136
– loop 145
– parallel, in series 142
– variothermal 143
tender specification 171
thermal expansion 115
three-plate mold 123
tolerances 49
transfer technique 76
transient calculation 177
tunnel gate 122
turntable molding 76
turntable mold technology 78
two-plate mold 98
two-stage ejector 153

U

unscrewing molds 158

V

vacuum brazing 147
Vicat softening temperature 206
voids 69

W

warpage analysis 176
weldability 80
weld lines 64